




MERCEDES B: 1EN0648			
Vinnumber:	WDD2462011J141211	Versionname:	B 200 CDI BE 136PK
First Registrationdate:	31/01/2013	Fiscalpower:	
Expertise Mileage:	91241	Power Kw:	100
Bodytype:	Hatchback	Body color:	Black
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2823
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options	
Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	No GPS
Type of Lining	Lining fabrics
Type of climate control	Manual climate control

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
Summer tyres:	205/55/16/91 H LightMetal			
	Fr.L.	Michelin: 2 mm	Fr.R.	Michelin: 2 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment			
Repair kit	Yes	Compressor	Yes
Total cost ex VAT			1815,05
Ignition key, Missing, E - Replace			150,00
<i>No pictures to display</i>			
Door R L, Scratch(es), LI - Repair and paint (complete)			318,35

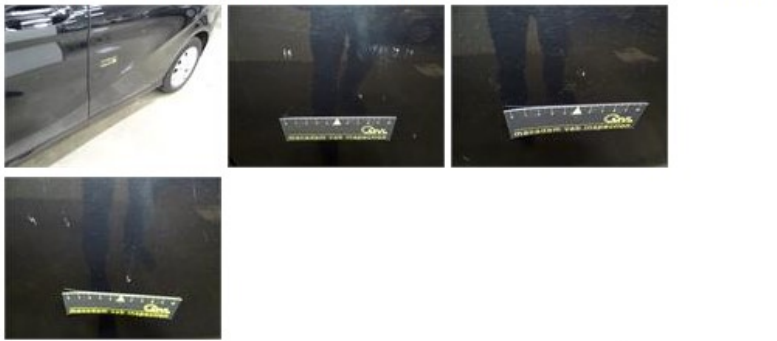

Alloy rim F.R. Scratch(es), Acceptable			0,00
--	--	--	-------------

Alloy rim F L, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Door F R, Scratch(es), LI - Repair and paint (complete) 318,35



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



Roof pillar L, Bad repair, Acceptable 0,00



Bonnet, Stone chip(s), Acceptable 0,00

No pictures to display

Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80



Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Door R R, Scratch(es), LI - Repair and paint (complete) 318,35



