



VOLVO XC70: 1FOD482			
Vinnnumber:	YV1BZ88A1E1180565	Versionname:	XC70 D4 Kinetic 163PK
First Registrationdate:	4/09/2013	Fiscalpower:	
Expertise Mileage:	69995	Power Kw:	120
Bodytype:		Body color:	Dark Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2428
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options	
Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining leather
Type of climate control	Autom climate control

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


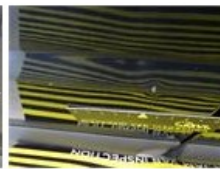













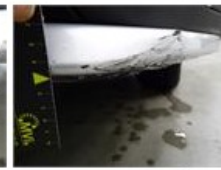






Degree of wear				
	235/55/17/99 H LightMetal			
Summer tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm


Assistance equipment			
Repair kit	Yes	Compressor	Yes
Total cost ex VAT			1496,23
Alloy rim R R, Scratch(es), LI - Repair and paint (complete)			95,00



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)	382,02
---------------------------------------------------------------------	---------------



		Bumper spoiler F, Scratch(es), E - Replace	92,00	
			Wing moulding F L, Scratch(es), E - Replace	74,00
		Rocker panel inner R R, Dent(s), LI - Repair and paint (complete)	115,56	
		Alloy rim F L, Scratch(es), LI - Repair and paint (complete)	95,00	
		Wing R L, Scratch(es), Acceptable	0,00	
<i>No pictures to display</i>				
Spoiler R, Scratch(es), E - Replace			128,00	
			Bumper moulding F R, Scratch(es), E - Replace	17,28
		Door F L, Scratch(es), Acceptable	0,00	
<i>No pictures to display</i>				
Door F R, Scratch(es), Acceptable			0,00	
<i>No pictures to display</i>				
		Bumper moulding F L, Scratch(es), E - Replace	17,28	
		Rearlight R, Scratch(es), E - Replace	132,00	
		Bonnet, Chemical polution, LI - Repair and paint (complete)	348,09	

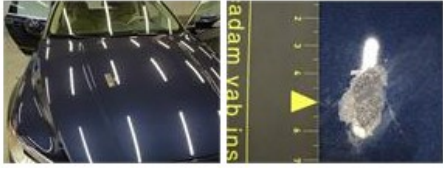

adam yab ins