



**VOLVO S60: 1NHF471**

Vinnumber:	<b>YV1FS79C1G2409602</b>	Versionname:	<b>2.0 D3 MOMENTUM R-DESIGN</b>
First Registrationdate:	<b>24/02/2016</b>	Fiscalpower:	
Expertise Mileage:	<b>154821</b>	Power Kw:	<b>110</b>
Bodytype:	<b>Berline</b>	Body color:	<b>Black</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Maintenance:	<b>OK</b>	Parking lot:	<b>4305</b>
Battery functioning:	<b>Yes</b>		
Number of doors:	<b>4</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD	Central consol F
GPS storage	Rear parking sensors
GPS storage	HD
Windows electric F	Type of Tow bar
Windows electric R	<b>No Tow bar</b>
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	<b>Headlighting Halogen</b>
Type of GPS	<b>GPS big screen color</b>
Type of Lining	<b>Lining leather</b>
Type of climate control	<b>Autom climate control</b>

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>235/40/18/95 W LightMetal</b>			
Summer tyres:	Fr.L.	<b>Continental: 6 mm</b>	Fr.R.	<b>Continental: 6 mm</b>
	Re.L.	<b>Continental: 5 mm</b>	Re.R.	<b>Continental: 5 mm</b>

**Assistance equipment**

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
------------	------------	------------	------------

Total cost ex VAT	5107,80
-------------------	---------

Roof, Scratch(es), LI - Repair and paint (complete)	481,50
---	--------



Alloy rim R R polished, Scratch(es), E - Replace	235,20
--	--------



Sill outer R, Dent(s) and scratch(es), LI - Repair and paint (complete) 310,50



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



Windscreen, Stone chip(s), Acceptable 0,00



Tyre F R, Tear, E - Replace 132,00



Bumper F, Scratch(es), LI - Repair and paint (complete) 250,00



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



Alloy rim F L polished, Scratch(es), E - Replace 235,20



Tyre R R, Tear, E - Replace 132,00



Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 366,35





Alloy rim F R polished, Scratch(es), E - Replace 235,20




Tailgate, Scratch(es), Acceptable 0,00

No pictures to display

Tyre R L, Tear, E - Replace 132,00



Bonnet, Chemical pollution, LI - Repair and paint (complete) 290,08

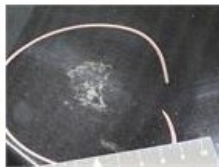

Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete) 211,80



Wing F R, Dent(s) and scratch(es), Le - Replace and paint 530,02



Headlight R, Scratch(es), E - Replace 396,00



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35



Alloy rim R L polished, Scratch(es), E - Replace 235,20

