



**BMW 4 GRAN COUPE: KY1976**

Vinnumber:	<b>WBA4B71050D422208</b>	Versionname:	<b>2.0 420D XDRIVE (135KW) 4WD GRAN COUPE</b>
First Registrationdate:	<b>1/01/2020</b>	Fiscalpower:	
Expertise Mileage:	<b>124326</b>	Power Kw:	<b>135</b>
Bodytype:		Body color	<b>Black</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type	<b>Metalic</b>
Transmission:		Rims summer	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level	<b>OK</b>
Battery functioning	<b>Yes</b>	Parking lot	<b>1211</b>
Number of doors	<b>5</b>		
Number of seats	<b>5</b>		
Number head rests	<b>5</b>		
Rims summer	<b>Aluminium</b>		
Category	<b>Passenger Car</b>		
Oil level	<b>OK</b>		

**Options**

Radio CD	Central consol F
Windows electric F	Front parking sensors
Windows electric R	Rear parking sensors
Cruise Control	Type of Tow bar
Steering wheel multifunctional	<b>No Tow bar</b>
Radio multimedia	
Type of headlighting	<b>Headlighting Halogen</b>
Type of GPS	<b>GPS big screen color</b>
Type of Lining	<b>Lining leather</b>
Type of climate control	<b>Autom climate control</b>

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>225/50/17/94 W LightMetal</b>			
Summer tyres:	Fr.L.	<b>Hankook: 3 mm</b>	Fr.R.	<b>Hankook: 3 mm</b>
	Re.L.	<b>Hankook: 3 mm</b>	Re.R.	<b>Hankook: 3 mm</b>

**Assistance equipment**

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
------------	------------	------------	------------

Total cost ex VAT	<b>1287,03</b>
-------------------	----------------

Door R L, Chemical polution, 67 - Polish	<b>0,00</b>
--	-------------

*No pictures to display*

Roof, Chemical polution, LI - Repair and paint (complete)	<b>577,80</b>
---	---------------



Wing F R, Chemical polution, LI - Repair and paint (complete)	<b>264,24</b>
---	---------------

Wing F R, Chemical polution, LI - Repair and paint (complete) 204,21



Bumper F, Scratch(es), Acceptable 0,00

No pictures to display

Windscreen, Stone chip(s), Acceptable 0,00

No pictures to display


Door R R, Scratch(es), LI - Repair and paint (complete) 382,02



Door F L, Chemical polution, 67 - Polish 0,00

No pictures to display

Door F R, Dent(s), PDR - Knock out without painting 63,00

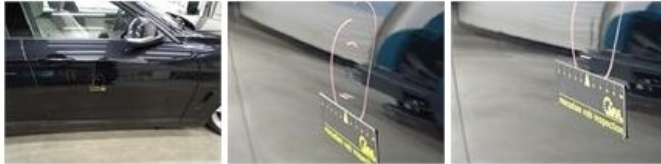

Bonnet, Chemical polution, 67 - Polish 0,00

No pictures to display