



RENAULT Grand Scenic: 1FHM242

Vinnumber:	VF1JZ14P649259207	Versionname:	GRAND SCENIC Authentique 7pl.110PK
First Registrationdate:	1/07/2013	Fiscalpower:	
Expertise Mileage:	183934	Power Kw:	81
Bodytype:	MPV	Body color:	Dark Red
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2621
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD	Type of Tow bar	Tow bar fixed
Windows electric F		
Cruise Control		
Steering wheel multifunctional		
Radio multimedia		
Type of headlighting	Headlighting Halogen	
Type of GPS	No GPS	
Type of Lining	Lining fabrics	
Type of climate control	Manual climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear


	205/60/16/96 H Steel			
Summer tyres:	Fr.L.	Michelin: 6 mm	Fr.R.	Michelin: 6 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Emergency spare wheel	Yes
-----------------------	------------

Total cost ex VAT	3243,81
-------------------	---------

Roof, Chemical pollution, LI - Repair and paint (complete)	481,50
--	--------

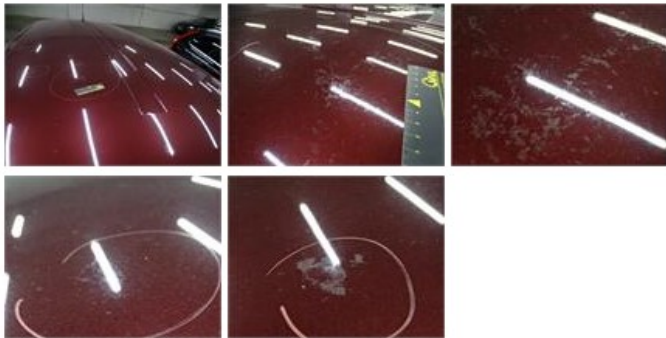

Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)	308,20
---	--------



Rocker panel inner R L, Dent(s), LI - Repair and paint (complete) 115,56



Rocker panel inner R R, Dent(s), LI - Repair and paint (complete) 115,56



Bumper grille, Dent(s) and scratch(es), E - Replace 32,40



Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Scratch(es), LI - Repair and paint (complete) 318,35



Door R R, Scratch(es), LI - Repair and paint (complete) 318,35



Tailgate, Dent(s) and scratch(es), LI - Repair and paint (complete) 301,68



Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete) 211,80




Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Bonnet, Chemical polution, LI - Repair and paint (complete) 290,08



Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35

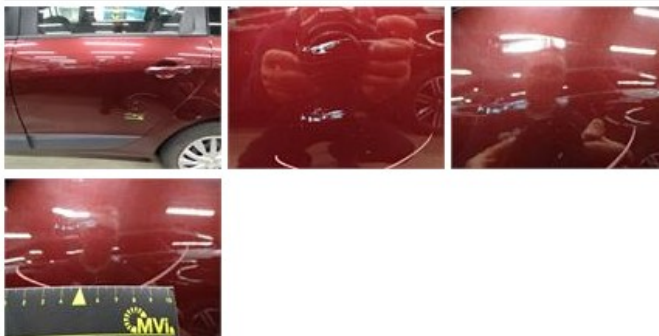

Luggage space cover, Missing, E - Replace 0,00



Roof pillar R, Dent(s), LI - Repair and paint (complete) 220,18

