


RENAULT Grand Scenic: 1FTC516

Vinnumber:	VF1JZ14M649761096	Versionname:	GRAND SCENIC Business
First Registrationdate:	16/10/2013	Fiscalpower:	Spl.110PK
Expertise Mileage:	111894	Power Kw:	81
Bodytype:		Body color:	Silver
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4731
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	SD	Luggage cover	
GPS storage		Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/60/16/96 H Steel			
Summer tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT 782,94

Boot carpet, Missing, E - Replace 100,00



Bodywork, Not original part, Remove lettering 0,00

No pictures to display

Wheel cover R L, Missing, E - Replace 30,00



Trunk lid covering R, Scratch(es), E - Replace 54,60



Wheel cover R R, Scratch(es), E - Replace 30,00



Bumper F, Scratch(es), LI - Repair and paint (complete) 0,00



Spoiler R, Scratch(es), E - Replace 89,00




Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 0,00



Sill outer R, Dent(s) and scratch(es), LI - Repair and paint (complete) 0,00



Bumper R, Dent(s) and scratch(es), Le - Replace and paint 0,00

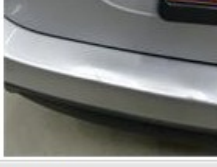

Dashboard, Scratch(es), Acceptable 0,00

No pictures to display

Protection plate M, Hole, E - Replace 64,60



Door moulding Lower R R, Scratch(es), LI - Repair and paint (complete) 0,00



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 0,00



Interior, Stain, Cleaning 25,00



Wing F R, Scratch(es), LI - Repair and paint (complete) 220,18



Wheel cover F R, Missing, E - Replace 30,00



Door R R, Scratch(es), LI - Repair and paint (complete) 0,00



Rearview mirror housing L, Scratch(es), LI - Repair and paint (complete) 115,56



Luggage space cover, Damaged, Repair/replace (lump sum) 24,00



Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 0,00



