



VOLVO V60: 1HXF759

Vinnnumber:	YV1FW31A1F1240246	Versionname:	V60 BRE D3 Kinetic 136PK
First Registrationdate:	20/10/2014	Fiscalpower:	
Expertise Mileage:	95115	Power Kw:	100
Bodytype:	Break	Body color:	Dark Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	4804
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	HD	Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	NOT OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	215/55/16/97 V LightMetal			
Summer tyres:	Fr.L.	Continental: 1,6 mm	Fr.R.	Continental: 1,6 mm
	Re.L.	Continental: 4 mm	Re.R.	Continental: 4 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	1635,61
-------------------	---------

Wing F L, Dent(s) and scratch(es), LI - Repair and paint (complete)	340,18
---	--------




Rearview mirror housing L, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Bumper R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Bonnet, Chemical polution, LI - Repair and paint (complete)	290,08
---	--------

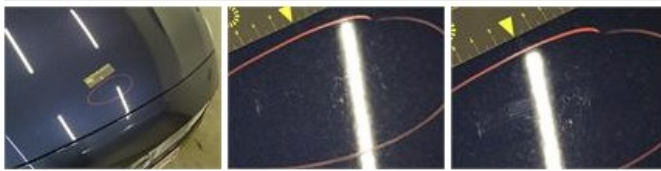

Rear window, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 380,20



Door R R, Scratch(es), LI - Repair and paint (complete) 318,35



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Bumper F L, Scratch(es), LI - Repair and paint (complete) 211,80

