




OPEL Astra: 1EKV792			
Vinnnumber:	W0LPD8EW5D8028803	Versionname:	ASTRA BRE ecoFLEX Enjoy St/St 110PK
First Registrationdate:	9/01/2013	Fiscalpower:	
Expertise Mileage:	100394	Power Kw:	81
Bodytype:		Body color	Grey
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Steel
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	2631
Number of doors	5		
Number of seats	5		
Number head rests	4		
Rims summer	Steel		
Category	Passenger Car		
Oil level	OK		

Options			
Radio CD		Luggage cover	
GPS storage		Front parking sensors	
GPS storage	SD	Rear parking sensors	
Windows electric F		Type of Tow bar	Tow bar removable
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS base		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear			
Summer tyres:	215/60/16/95 V Steel		
	Fr.L.	Bridgestone: 4 mm	Fr.R. Continental: 5 mm
	Re.L.	Continental: 5 mm	Re.R. Bridgestone: 4 mm

Assistance equipment			
Repair kit	Yes	Compressor	Yes
Total cost ex VAT			778,44
Wing F L, Dent(s), It - Spot repair			115,56

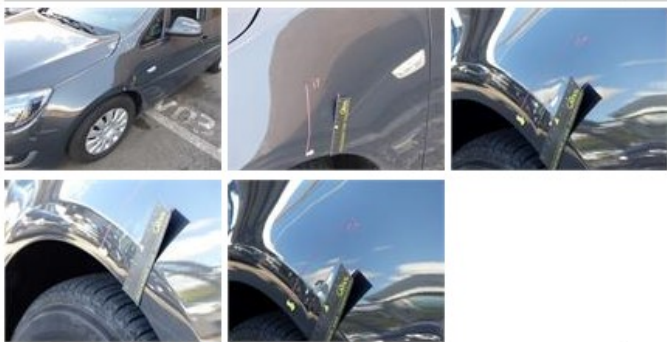

Window F R door, Scratch(es), Acceptable	0,00
No pictures to display	

Seat cover R, Stain, Cleaning	25,00
 	
Tailgate, Dent(s) and scratch(es), Acceptable	0,00
No pictures to display	
Door panel F L, Scratch(es), Acceptable	0,00
No pictures to display	
Window F L door, Scratch(es), Acceptable	0,00
No pictures to display	
Door R L, Scratch(es), Acceptable	0,00
No pictures to display	
Internal Boot Lining L, Scratch(es), Acceptable	0,00
No pictures to display	
Side window R R, Scratch(es), 67 - Polish	55,19
     	
Wing R L, Dent(s) and scratch(es), Acceptable	0,00
No pictures to display	
Door frame F L, Dent(s), Acceptable	0,00
No pictures to display	
Tyre R R, Not original part, Acceptable	0,00
       	
Window R R door, Scratch(es), 67 - Polish	55,19
    	
Window R L door, Scratch(es), 67 - Polish	55,19
  	



Glove compartment lid, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Door F R, Dent(s), PDR - Knock out without painting	63,00
---	-------



Rear Panel Internal Lining, Scratch(es), Acceptable	0,00
---	------

No pictures to display

Wing R R, Dent(s) and scratch(es), Acceptable	0,00
---	------

No pictures to display

Door F L, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Wheel cover F L, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Wing F R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display


Internal Boot Lining R, Scratch(es), Acceptable	0,00
---	------

No pictures to display

Bumper F, Repaired, Acceptable	0,00
--------------------------------	------

No pictures to display

Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)	259,80
---	--------

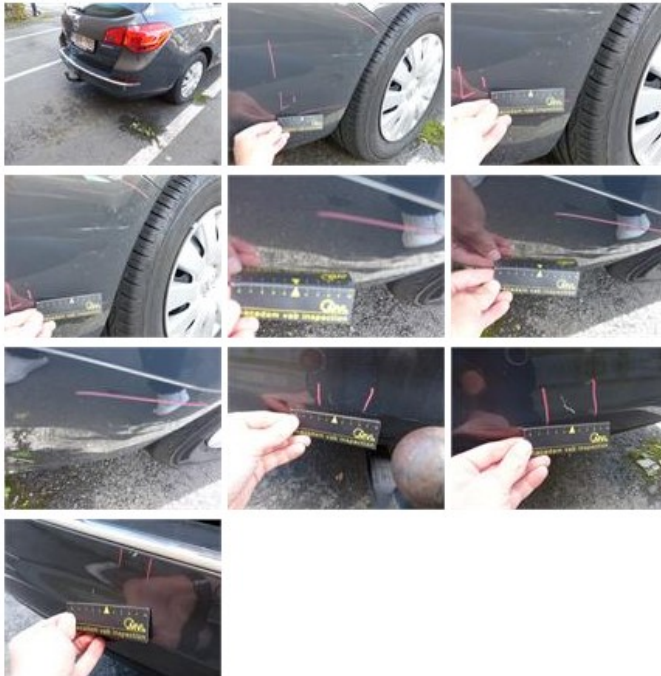

Side window R L, Scratch(es), 67 - Polish	55,19
---	-------



Wheel cover F R, Scratch(es), E - Replace	30,00
---	-------



Rearview mirror R complete, Scratch(es), Acceptable	0,00
---	------

No pictures to display

Ceiling, Damaged, Smart repair	64,32
--------------------------------	-------



Door frame F L, Scratch(es), Acceptable	0,00
---	------

No pictures to display

Door R R, Dent(s) and scratch(es), Acceptable	0,00
---	------

No pictures to display

Floor covering F L, Worn, Acceptable	0,00
--------------------------------------	------

No pictures to display

Trunk lid covering R, Scratch(es), Acceptable	0,00
---	------

No pictures to display

Rear window, Scratch(es), Acceptable	0,00
--------------------------------------	------

No pictures to display

Luggage space cover, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Windscreen, Scratch(es), Acceptable	0,00
-------------------------------------	------

No pictures to display

Wheel cover R R, Scratch(es), Acceptable	0,00
--	------

No pictures to display