



BMW 3: 1HGR508			
Vinnumber:	WBA3D91090J414647	Versionname:	3 BER 316d 116PK
First Registrationdate:	16/07/2014	Fiscalpower:	
Expertise Mileage:	64417	Power Kw:	85
Bodytype:		Body color	Dark Blue
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:		Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	2506
Number of doors	4		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options			
Radio CD		Central consol F	
Windows electric F		Front parking sensors	
Windows electric R		Rear parking sensors	
Cruise Control		Type of Tow bar	No Tow bar
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear				
	225/50/17/94 W LightMetal			
Summer tyres:	Fr.L.	Dunlop: 5 mm	Fr.R.	Dunlop: 5 mm
	Re.L.	Dunlop: 3 mm	Re.R.	Dunlop: 3 mm

Assistance equipment	
Runflat	Yes
Total cost ex VAT	1941,58
Bumper F, Scratch(es), LI - Repair and paint (complete)	211,80



Rearview mirror R complete, Broken, Le - Replace and paint	283,00
---	---------------



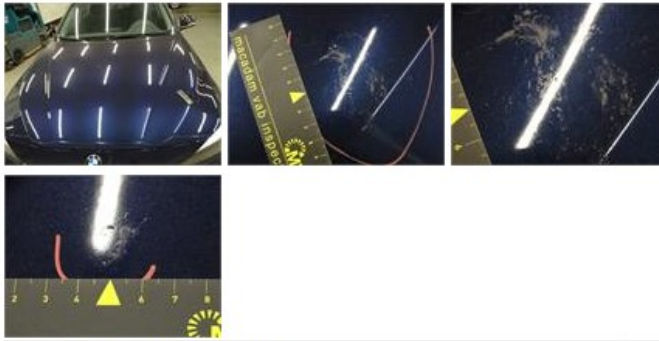


Door F L, Scratch(es), Acceptable

0,00

No pictures to display

Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35

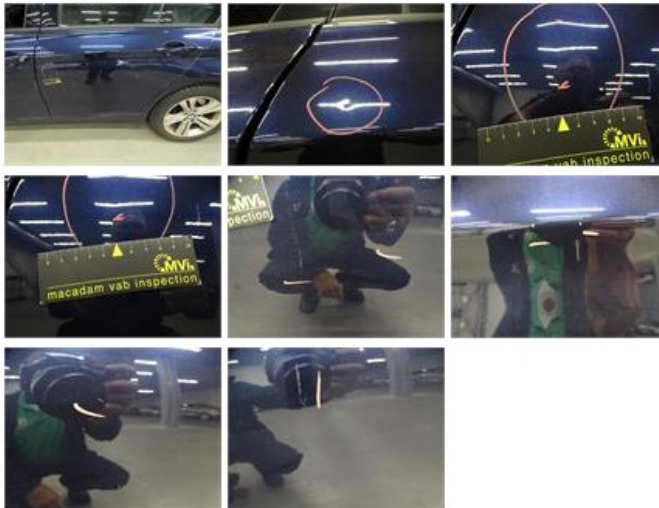

Door R R, Scratch(es), LI - Repair and paint (complete)

318,35



Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Wing R R, Scratch(es), LI - Repair and paint (complete)

308,20



Door F R, Scratch(es), Acceptable

0,00

No pictures to display