


**BMW 3: 1FMM712**

Vinnnumber:	<b>WBA3K91060F931462</b>	Versionname:	<b>3 TOURING 316d 116PK</b>
First Registrationdate:	<b>20/08/2013</b>	Fiscalpower:	
Expertise Mileage:	<b>177752</b>	Power Kw:	<b>85</b>
Bodytype:	<b>Break</b>	Body color:	<b>Grey</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Back</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Maintenance:	<b>OK</b>	Parking lot:	<b>3426</b>
Battery functioning:	<b>Yes</b>		
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		

**Options**

Radio CD		Central consol F	
GPS storage	<b>HD</b>	Luggage cover	
GPS storage		Rear parking sensors	
Windows electric F		Type of Tow bar	<b>Tow bar removable</b>
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	<b>Headlighting Halogen</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining fabrics</b>		
Type of climate control	<b>Autom climate control</b>		

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>205/60/16/92 W LightMetal</b>			
Summer tyres:	Fr.L.	<b>Michelin: 5 mm</b>	Fr.R.	<b>Michelin: 5 mm</b>
	Re.L.	<b>Goodyear: 7 mm</b>	Re.R.	<b>Goodyear: 7 mm</b>


**Assistance equipment**

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
------------	------------	------------	------------

Total cost ex VAT	<b>1158,10</b>
Door R L, Scratch(es), Acceptable	<b>0,00</b>
<i>No pictures to display</i>	
Wing R L, Dent(s), Acceptable	<b>0,00</b>
<i>No pictures to display</i>	
Backrest cover F R, Scratch(es), Acceptable	<b>0,00</b>
<i>No pictures to display</i>	
Door R R, Scratch(es), Acceptable	<b>0,00</b>
<i>No pictures to display</i>	
Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)	<b>259,80</b>



Roof, Dent(s), LI - Repair and paint (complete)	625,50
---	--------

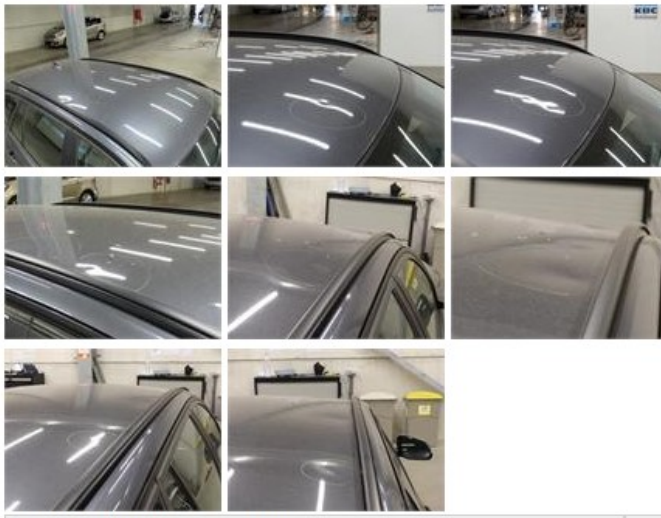

Wing R R, Scratch(es), Acceptable	0,00
-----------------------------------	------

*No pictures to display*

Door panel F L, Crack, E - Replace	114,00
------------------------------------	--------



Boot carpet, Damaged, E - Replace	100,00
-----------------------------------	--------



Windscreen, Stone chip(s), Windscreen repair	58,80
--	-------



Door panel R R, Scratch(es), Acceptable	0,00
---	------

*No pictures to display*

Door F L, Dent(s), Acceptable	0,00
-------------------------------	------

*No pictures to display*