


BMW 318 GT: 1GG5793

Vinnnumber:	WBA3Y11060D375567	Versionname:	3 GRAN TURISMO 318dA
First Registrationdate:	4/02/2014	Fiscalpower:	136PK Aut.
Expertise Mileage:	151375	Power Kw:	100
Bodytype:		Body color:	Black
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	NOT OK	Parking lot:	2632
Maintenance:	UITVOEREN		
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	HD	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	Tow bar removable
Cruise Control			
Steering wheel multifunctional			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/55/17/101 W LightMetal				
Summer tyres:	Fr.L.	Vredestein: 7 mm	Fr.R.	Vredestein: 7 mm
	Re.L.	Vredestein: 6 mm	Re.R.	Vredestein: 6 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	1917,18
-------------------	----------------

Door F R, Dent(s), Acceptable	0,00
-------------------------------	-------------



Alloy rim F R, Scratch(es), Acceptable	0,00
--	-------------



Door panel R L, Scratch(es), Acceptable 0,00



Roof pillar L, Scratch(es), Acceptable 0,00



Bonnet, Scratch(es), Acceptable 0,00




Trunk lid covering R, Scratch(es), Acceptable 0,00



Wing F R, Dent(s), LI - Repair and paint (complete) 268,18



Wing R R, Scratch(es), Acceptable 0,00

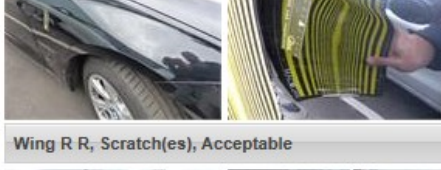

Windscreen, Stone chip(s), E - Replace 487,20



Maintenance, Maintenance, Execute 0,00



Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Bumper F, Broken, Le - Replace and paint 735,00



Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete) 331,80

