



**PEUGEOT Boxer 330: 1FE0017**

Vinnnumber:	<b>VF3YASMFA12328667</b>	Versionname:	<b>BOXER 330 B/F SWB L1H1 FAP 110PK</b>
First Registrationdate:	<b>7/06/2013</b>	Fiscalpower:	
Expertise Mileage:	<b>62154</b>	Power Kw:	<b>81</b>
Bodytype:		Body color:	<b>Black</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Steel</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Maintenance:	<b>GEEN MELDING</b>	Parking lot:	<b>LCV30</b>
Maintenance:	<b>OK</b>		
Battery functioning:	<b>Yes</b>		
Number of doors:	<b>5</b>		
Number of seats:	<b>3</b>		
Number head rests:	<b>3</b>		
Rims summer:	<b>Steel</b>		
Category:	<b>Light Commercial Vehicle</b>		
Oil level:	<b>OK</b>		

**Options**

Radio CD	Central consol F	
Windows electric F	Rear parking sensors	
Steering wheel multifunctional	Type of Tow bar	<b>No Tow bar</b>
Type of headlighting	<b>Headlighting Halogen</b>	
Type of Lining	<b>Lining fabrics</b>	
Type of climate control	<b>Manual climate control</b>	

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>215/70/15/109 S Steel</b>			
Summer tyres:	Fr.L.	<b>Continental: 7 mm</b>	Fr.R.	<b>Continental: 7 mm</b>
	Re.L.	<b>Continental: 9,9 mm</b>	Re.R.	<b>Continental: 9,9 mm</b>

**Assistance equipment**

Spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
-------------	------------	------	------------

Total cost ex VAT 2682,10

Bumper moulding R L, Deformed / Strained, E - Replace 10,80



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 231,15





Door F R, Scratch(es), LI - Repair and paint (complete) 238,76



Bumper R, Broken, E - Replace 329,40



Trunk door panel L, Broken, E - Replace 60,00



Bumper corner R R, Scratch(es), Acceptable 0,00

No pictures to display

Trunk door panel R, Broken, E - Replace 60,00



Instruction book, Missing, E - Replace 0,00

No pictures to display

Trunk door R L, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Central pillar R, Dent(s), It - Spot repair 115,56



Sill outer R, Dent(s) and scratch(es), It - Spot repair 115,56



Rearview mirror R complete, Broken, E - Replace 138,00



Trunk door R R, Dent(s) and scratch(es), Acceptable 0,00

No pictures to display

Rearview mirror housing L, Scratch(es), Acceptable 0,00

No pictures to display

Door moulding Lower R R, Missing, E - Replace 91,50



Bonnet, Chemical pollution, LI - Repair and paint (complete) 217,56




Door panel F L, Worn, Acceptable 0,00



Door frame F L, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 231,15

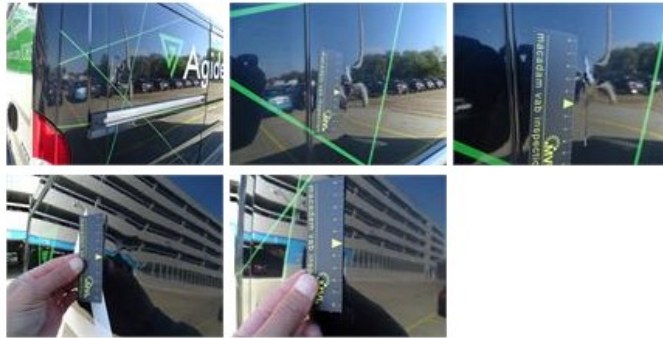

Bumper F L, Scratch(es), Smart repair 110,64



Trunk door R L, Dent(s) and scratch(es), Le - Replace and paint 350,00



Sliding door R, Dent(s), LI - Repair and paint (complete) 382,02

