


**BMW 3: 1FRM433**

Vinnnumber:	<b>WBA3Y31080D348821</b>	Versionname:	<b>3 GRAN TURISMO 320dA</b>
First Registrationdate:	<b>2/10/2013</b>	Fiscalpower:	<b>184PK Aut.</b>
Expertise Mileage:	<b>70129</b>	Power Kw:	<b>135</b>
Bodytype:		Body color:	<b>Black</b>
Gearbox:	<b>Automatic</b>	Paint type:	<b>Metalic</b>
Transmission:		Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>2415</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD		Seats electric F L	
Windows electric F		Seats electric F R	
Windows electric R		Central consol F	
Cruise Control		Front parking sensors	
Steering wheel multifunctional		Rear parking sensors	
Seats F heated		Type of Tow bar	<b>No Tow bar</b>
Radio multimedia			
Type of headlighting	<b>Headlighting Xenon</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining leather</b>		
Type of climate control	<b>Autom climate control</b>		
Sport seats			

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>255/40/19/96 W LightMetal</b>			
Summer tyres:	Fr.L.	<b>Pirelli: 4 mm</b>	Fr.R.	<b>Pirelli: 4 mm</b>
	Re.L.	<b>Pirelli: 4 mm</b>	Re.R.	<b>Pirelli: 4 mm</b>

**Assistance equipment**

 Runflat **Yes**

 Total cost ex VAT **1619,71**

 Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete) **318,35**

 Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete) **95,00**




Door R R, Dent(s), Acceptable 0,00

No pictures to display

Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 308,20



Rearview mirror housing L, Scratch(es), LI - Repair and paint (complete) 115,56

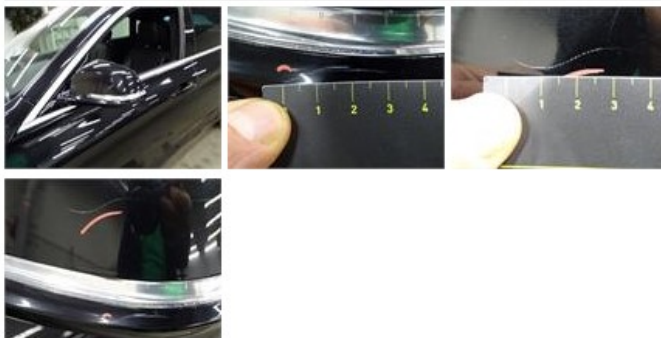

Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80



Door F L, Scratch(es), 67 - Polish 0,00

No pictures to display

Wing F L, Scratch(es), 67 - Polish 0,00

No pictures to display

Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete) 95,00





Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Protection plate M, Tear, E - Replace 74,00

