



CITROEN Berlingo: 618BWJ

Vinnnumber:	VF77D9HSCAJ693335	Versionname:	BERLINGO B/F PLC kort Pro FAP 90PK Spec.
First Registrationdate:	22/07/2010	Fiscalpower:	
Expertise Mileage:	132069	Power Kw:	66
Bodytype:	Transporter	Body color:	Grey
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	4727
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	3		
Number head rests:	3		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD	Type of Tow bar	Tow bar fixed
Windows electric F		
Cruise Control		
Type of headlighting	Headlighting Halogen	
Type of GPS	No GPS	
Type of Lining	Lining artificial leather	
Type of climate control	Manual climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	195/65/14/91 H Steel			
Winter tyres:	Fr.L.	Kleber: 1,6 mm	Fr.R.	Kleber: 1,6 mm
	Re.L.	Kleber: 2 mm	Re.R.	Kleber: 2 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT 273,13


Trunk door R L, Dent(s), Acceptable 0,00

No pictures to display

Bodywork, Not original part, Acceptable 0,00

No pictures to display

Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete) 165,13

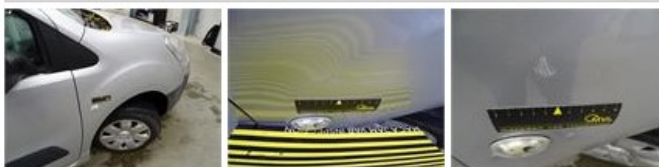

Ignition key, Not functioning (well), Acceptable 0,00

No pictures to display

Sidewall RR (LCV), Scratch(es), Acceptable 0,00

No pictures to display

Wheel cover R L, Scratch(es), Acceptable 0,00

No pictures to display

Sidewall RL (LCV), Scratch(es), Acceptable	0,00
--	------

No pictures to display

Roof, Dent(s), PDR - Paintless dent repair	63,00
--	-------



Steering wheel, Worn, Acceptable	0,00
----------------------------------	------



Bumper F, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Wheel cover R R, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Bumper R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Wheel cover F L, Broken, E - Replace	22,50
--------------------------------------	-------



Wheel cover F R, Broken, E - Replace	22,50
--------------------------------------	-------



Seat cover F L, Hole, Acceptable	0,00
----------------------------------	------

