


**FORD Fiesta: SM8213**

Vinnumber:	<b>WF0DXXGAKDEL75977</b>	Versionname:	<b>FIESTA BER Trend ECONetic S/S 95PK</b>
First Registrationdate:	<b>23/01/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>176014</b>	Power Kw:	<b>70</b>
Bodytype:	<b>Hatchback</b>	Body color:	<b>Blue</b>
Gearbox:	<b>MAN 5 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Steel</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Maintenance:	<b>OK</b>	Parking lot:	<b>4121</b>
Battery functioning:	<b>Yes</b>		
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>4</b>		
Rims summer:	<b>Steel</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD	Luggage cover
Windows electric F	Type of Tow bar <b>No Tow bar</b>
Steering wheel multifunctional	
Type of headlighting <b>Headlighting Halogen</b>	
Type of GPS <b>No GPS</b>	
Type of Lining <b>Lining fabrics</b>	
Type of climate control <b>Manual climate control</b>	

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>


**Degree of wear**

	<b>175/65/14/82 T Steel</b>			
Winter tyres:	Fr.L.	<b>Continental: 1,8 mm</b>	Fr.R.	<b>Continental: 1,8 mm</b>
	Re.L.	<b>Bridgestone: 3 mm</b>	Re.R.	<b>Bridgestone: 3 mm</b>

**Assistance equipment**


Spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
-------------	------------	------	------------

Total cost ex VAT	1624,66
Wheel cover F R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Interior, Dirty, Acceptable	0,00
<i>No pictures to display</i>	
Bumper R, Scratch(es), LI - Repair and paint (complete)	169,44

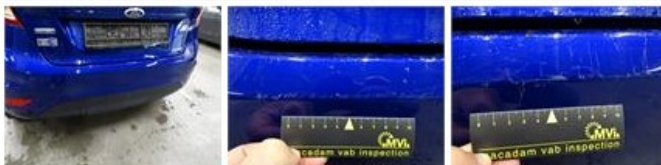



Door F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)	302,68

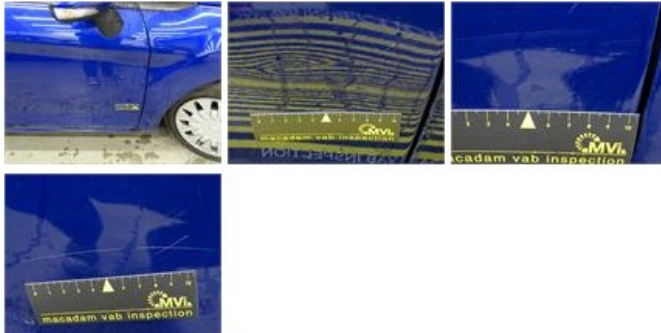

Bumper F, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door R R, Dent(s), PDR - Paintless dent repair	63,00




Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete)	296,14
---	--------



Door R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wing R R, Dent(s) and scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Trunk lid covering R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door R L, Dent(s) and scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Roof, Scratch(es), LI - Repair and paint (complete)	385,20



Bonnet, Chemical pollution, LI - Repair and paint (complete)	232,06
--	--------

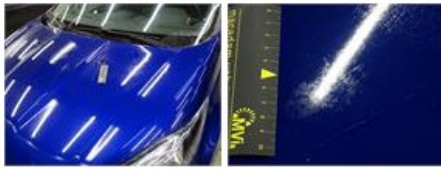

Wing R L, Scratch(es), Acceptable	0,00
-----------------------------------	------

*No pictures to display*

Wheel cover R R, Scratch(es), Acceptable	0,00
--	------

*No pictures to display*

Wing F L, Scratch(es), LI - Repair and paint (complete)	176,14
---	--------

