



SEAT Alhambra: RE9055

Vinnnumber:	VSSZZZ7NZFV500236	Versionname:	ALHAMBRA Eco.Style DPF
First Registrationdate:	14/07/2014	Fiscalpower:	140PK
Expertise Mileage:	123945	Power Kw:	103
Bodytype:		Body color	Grey
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	4405
Number of doors	5		
Number of seats	7		
Number head rests	7		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD		Central consol F
GPS storage	SD	Luggage cover
GPS storage		Front parking sensors
Windows electric F		Rear parking sensors
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Radio multimedia		
Type of headlighting	Headlighting Xenon	
Type of GPS	GPS big screen color	
Type of Lining	Lining fabrics	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/50/17/98 V LightMetal				
Summer tyres:	Fr.L.	Continental: 4 mm	Fr.R.	Continental: 4 mm
	Re.L.	Continental: 6 mm	Re.R.	Continental: 6 mm

Assistance equipment

Total cost ex VAT	984,65
Wing R L, Dent(s), Acceptable	0,00
<i>No pictures to display</i>	
Bumper F, Scratch(es), LI - Repair and paint (complete)	254,16





Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Air vent R M, Broken, E - Replace 158,40



Trunk lid covering R, Crack, E - Replace 119,00




Rear wiper arm, Missing, E - Replace 10,00



Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Chemical polution, LI - Repair and paint (complete) 348,09

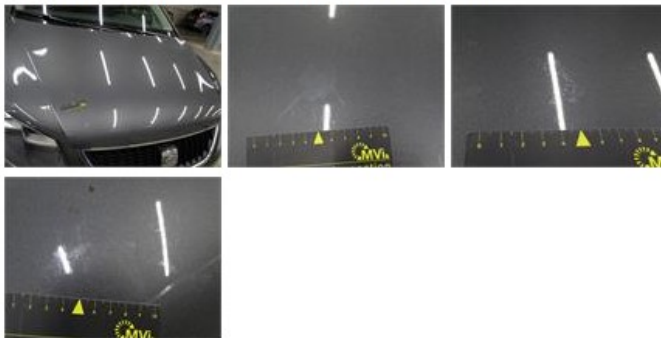

Rearview mirror housing R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00

