



**BMW 3 BERLINE: 1JPB443**

Vinnnumber:	<b>WBA3E11030P588984</b>	Versionname:	<b>2.0 320D EFFICIENTDYN. (120KW) BERLINE</b>
First Registrationdate:	<b>29/01/2015</b>	Fiscalpower:	
Expertise Mileage:	<b>87491</b>	Power Kw:	<b>120</b>
Bodytype:		Body color	<b>Brown</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type	<b>Metalic</b>
Transmission:	<b>Back</b>	Rims summer	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level	<b>OK</b>
Maintenance	<b>NOT OK</b>	Parking lot	<b>3510</b>
Battery functioning	<b>Yes</b>		
Number of doors	<b>5</b>		
Number of seats	<b>5</b>		
Number head rests	<b>5</b>		
Rims summer	<b>Aluminium</b>		
Category	<b>Passenger Car</b>		
Oil level	<b>OK</b>		
Registration Certificate Car (BE)	<b>Yes</b>		

**Options**

Radio CD		Sun Roof electric
GPS storage	<b>HD</b>	Central consol F
GPS storage		Rear parking sensors
Windows electric F		
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Radio multimedia		
Type of headlighting	<b>Headlighting Xenon</b>	
Type of GPS	<b>GPS big screen color</b>	
Type of Lining	<b>Lining fabrics</b>	
Type of climate control	<b>Autom climate control</b>	

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>205/60/16/92 W LightMetal</b>			
Summer tyres:	Fr.L.	<b>Pirelli: 5 mm</b>	Fr.R.	<b>Pirelli: 5 mm</b>
	Re.L.	<b>Pirelli: 3 mm</b>	Re.R.	<b>Pirelli: 3 mm</b>

**Assistance equipment**


Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
------------	------------	------------	------------

Total cost ex VAT	<b>507,30</b>
-------------------	---------------

Maintenance, Maintenance, Execute	<b>0,00</b>
-----------------------------------	-------------



Sill outer R, Scratch(es), LI - Repair and paint (complete)	<b>310,50</b>
---	---------------

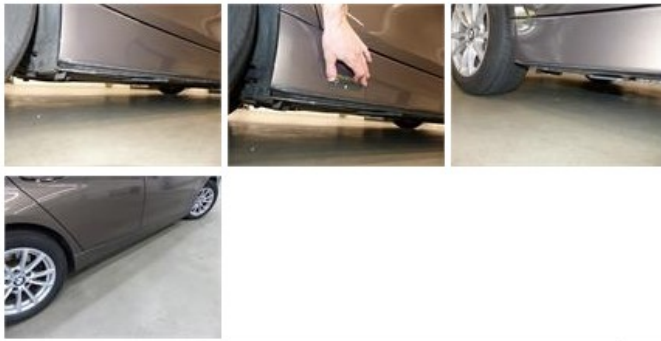

Alloy rim R R, Scratch(es), Acceptable 0,00

*No pictures to display*

Windscreen, Stone chip(s), Windscreen repair 58,80



Foglight R, Broken, E - Replace 138,00

