



**VOLKSWAGEN Caddy: 1DWT007**

Vinnnumber:	<b>WV1ZZZ2KZDX020397</b>	Versionname:	<b>CADDY MAXI VAN B/F</b>
First Registrationdate:	<b>20/09/2012</b>	Fiscalpower:	<b>102PK</b>
Expertise Mileage:	<b>36560</b>	Power Kw:	<b>75</b>
Bodytype:		Body color:	<b>Silver</b>
Gearbox:	<b>MAN 5 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Steel</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Maintenance:	<b>OK</b>	Parking lot:	<b>2716</b>
Battery functioning:	<b>Yes</b>		
Number of doors:	<b>5</b>		
Number of seats:	<b>2</b>		
Number head rests:	<b>2</b>		
Rims summer:	<b>Steel</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		

**Options**

Radio CD	Type of Tow bar	<b>No Tow bar</b>
Windows electric F		
Type of headlighting	<b>Headlighting Halogen</b>	
Type of GPS	<b>No GPS</b>	
Type of Lining	<b>Lining artificial leather</b>	
Type of climate control	<b>Manual climate control</b>	

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>195/65/15/91 T Steel</b>			
Summer tyres:	Fr.L.	<b>Other: 4 mm</b>	Fr.R.	<b>Other: 4 mm</b>
	Re.L.	<b>Bridgestone: 3 mm</b>	Re.R.	<b>Bridgestone: 3 mm</b>





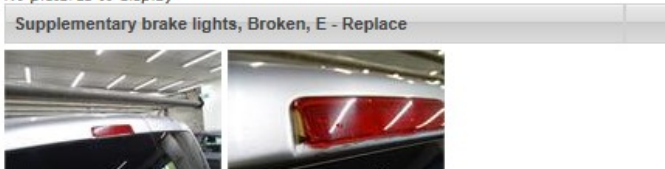
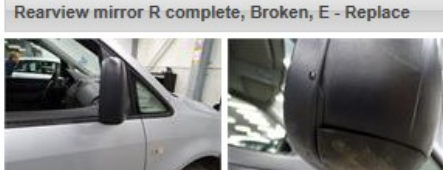
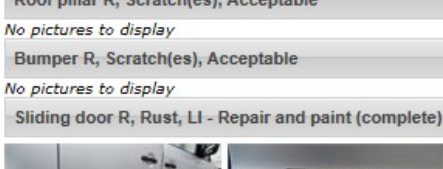

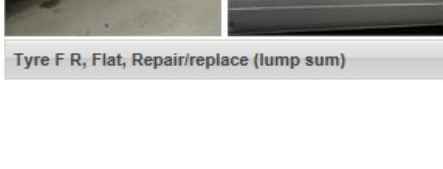


**Assistance equipment**

Spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
-------------	------------	------	------------

Total cost ex VAT	2083,52
Wing F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Roof, Not original part, Acceptable	0,00
<i>No pictures to display</i>	
Bumper F, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Bumper F, Missing, E - Replace	12,00



Rocker panel inner F R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Trunk door R L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Sill outer L, Rust, LI - Repair and paint (complete)	232,88

	Bonnet, Dent(s) and scratch(es), LI - Repair and paint (complete)	313,56
	Door F L, Rust, LI - Repair and paint (complete)	238,76
	Trunk lid covering R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>		
	Wing R L, Rust, LI - Repair and paint (complete)	231,15
	Trunk door R R, Dent(s), Acceptable	0,00
<i>No pictures to display</i>		
	Supplementary brake lights, Broken, E - Replace	33,00
	Rearview mirror R complete, Broken, E - Replace	138,00
	Roof pillar R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>		
	Bumper R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>		
	Sliding door R, Rust, LI - Repair and paint (complete)	382,02
	Tyre F R, Flat, Repair/replace (lump sum)	25,00



Backrest cover F L, Worn, Acceptable 0,00



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 327,15



Ignition key, Missing, E - Replace 150,00



Steering wheel, Worn, Acceptable 0,00

