



**FORD Fiesta: 1HXA843**

Vinnumber:	<b>WF0DXXGAKDEB66005</b>	Versionname:	<b>FIESTA BER EcoBoost Titanium S/S 125PK</b>
First Registrationdate:	<b>17/10/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>141636</b>	Power Kw:	<b>92</b>
Bodytype:		Body color:	<b>Anthracite</b>
Gearbox:	<b>MAN 5 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>3616</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD		Central consol F
GPS storage	<b>SD</b>	Luggage cover
GPS storage		Rear parking sensors
Windows electric F		
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Seats F heated		
Radio multimedia		
Type of headlighting	<b>Headlighting Halogen</b>	
Type of GPS	<b>GPS big screen color</b>	
Type of Lining	<b>Lining leather</b>	
Type of climate control	<b>Autom climate control</b>	

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

<b>25/40/17/82 Y LightMetal</b>				
Summer tyres:	Fr.L.	<b>Semperit: 3 mm</b>	Fr.R.	<b>Semperit: 3 mm</b>
	Re.L.	<b>Continental: 4 mm</b>	Re.R.	<b>Continental: 4 mm</b>

**Assistance equipment**

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
------------	------------	------------	------------

Total cost ex VAT	852,40
Seat cover F L, Hole, Smart repair	64,32



Tyre R R, Tear, E - Replace

110,40



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

95,00



Door F L, Scratch(es), Acceptable

0,00

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00



Bumper F, Scratch(es), Acceptable

0,00

No pictures to display


Protection plate M, Missing, E - Replace

75,00



Roof pillar L, Dent(s), PDR - Paintless dent repair

63,00

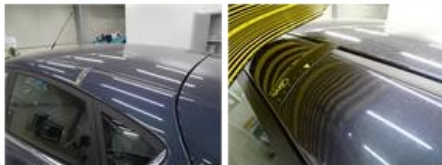

Tailgate, Dent(s), Acceptable

0,00

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete)

95,00



Alloy rim R L, Scratch(es), Acceptable

0,00

No pictures to display

Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

254,68

