


VOLKSWAGEN Golf: 1BSF286

Vinnnummer:	WVWZZZ1KZBM714427	Versionname:	GOLF BRE Highline BlueMot.DPF 105PK
First Registrationdate:	19/08/2011	Fiscalpower:	
Expertise Mileage:	89730	Power Kw:	77
Bodytype:	Break	Body color:	Black
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3615
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
GPS storage	Luggage cover
GPS storage	DVD
Windows electric F	
Windows electric R	
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	NOT OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/55/16/91 H LightMetal				
Summer tyres:	Fr.L.	Continental: 4 mm	Fr.R.	Continental: 4 mm
	Re.L.	Continental: 6 mm	Re.R.	Continental: 6 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT	1654,53
-------------------	----------------

Maintenance book, Missing, E - Replace	0,00
--	-------------

No pictures to display

Bonnet, Scratch(es), Acceptable	0,00
---------------------------------	-------------

No pictures to display


Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete)	95,00
---	--------------



Instruction book, Missing, E - Replace 0,00

No pictures to display

Door F L, Dent(s), LI - Repair and paint (complete) 366,35

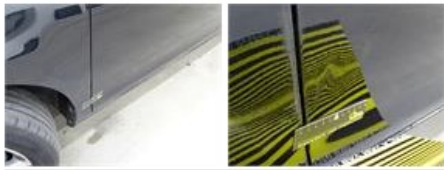

Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Door R L, Dent(s), Acceptable 0,00

No pictures to display

Wing R L, Scratch(es), Acceptable 0,00

No pictures to display

Door R R, Dent(s), Acceptable 0,00

No pictures to display

Bumper F, Crack, Le - Replace and paint 735,00



Alloy rim R R polished, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Wing F L, Dent(s), LI - Repair and paint (complete) 268,18

