



SKODA Octavia: 1EBN417

| | | | |
|------------------------------------|--------------------------|--------------|--|
| Vinnumber: | TMBHT21Z1D2068899 | Versionname: | OCTAVIA COMBI GTec Ambition DPF 105PK |
| First Registrationdate: | 11/10/2012 | Fiscalpower: | |
| Expertise Mileage: | 172013 | Power Kw: | 77 |
| Bodytype: | Break | Body color: | Grey |
| Gearbox: | MAN 5 VIT | Paint type: | Metalic |
| Transmission: | Front | Rims summer: | Aluminium |
| Fueltype: | Diesel | Oil level: | OK |
| Battery functioning: | Yes | Parking lot: | 1125 |
| Number of doors: | 5 | | |
| Number of seats: | 5 | | |
| Number head rests: | 5 | | |
| Rims summer: | Aluminium | | |
| Category: | Passenger Car | | |
| Oil level: | OK | | |
| Registration Certificate Car (BE): | Yes | | |

Options

| | | |
|--------------------------------|------------------------------|----------------------|
| Radio CD | | Central consol F |
| GPS storage | HD | Luggage cover |
| GPS storage | | Rear parking sensors |
| Windows electric F | | |
| Cruise Control | | |
| Steering wheel multifunctional | | |
| Radio multimedia | | |
| Type of headlighting | Headlighting Halogen | |
| Type of GPS | GPS big screen color | |
| Type of Lining | Lining fabrics | |
| Type of climate control | Autom climate control | |

Limited Technical Inspection

| | | | |
|---------------------|-----------|---------------------|---------------|
| Airco functioning | OK | Battery functioning | Yes |
| Tires wear profile | OK | Power steering | Yes |
| Idle position | OK | Sound engine | OK |
| Engine startingtime | OK | Clutch test | OK |
| Exhaust gass | OK | Wiper fluid level | OK |
| Handbrake | OK | Transmission | OK |
| | | Lighting | NOT OK |
| | | Wiperblades | OK |

Degree of wear

| | | | | |
|----------------------------------|-------|-----------------------|-------|-----------------------|
| 195/65/15/91 T LightMetal | | | | |
| Summer tyres: | Fr.L. | Uniroyal: 5 mm | Fr.R. | Uniroyal: 5 mm |
| | Re.L. | Uniroyal: 5 mm | Re.R. | Uniroyal: 5 mm |

Assistance equipment

| | | | |
|----------------------------------|------------|------|----------------|
| Spare wheel | Yes | Jack | Yes |
| Total cost ex VAT | | | 1068,24 |
| Steering wheel, Worn, Acceptable | | | 0,00 |



Wing F R, Scratch(es), It - Spot repair

115,56



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

95,00



Bumper F L, Scratch(es), It - Spot repair

115,56




Wing F L, Scratch(es), Acceptable

0,00

No pictures to display

Alloy rim R L, Scratch(es), LI - Repair and paint (complete)

95,00

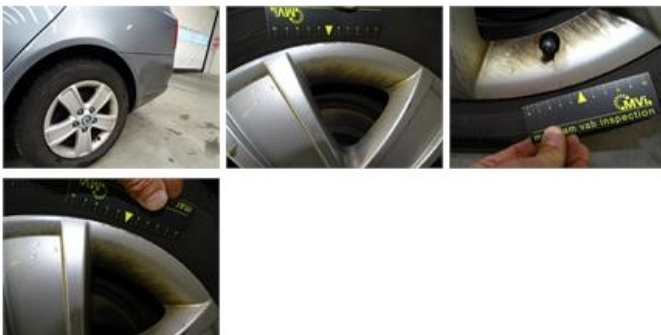

Bumper R, Hole, LI - Repair and paint (partial)

96,00



Tailgate, Dent(s), PDR - Paintless dent repair

63,00



Door R R, Scratch(es), It - Spot repair

115,56



Tailgate, Scratch(es), Acceptable

0,00

No pictures to display

Bonnet, Dent(s), Acceptable

0,00

No pictures to display

Bumper R, Repaired, Acceptable

0,00



Finish badge R, Incomplete, E - Replace

27,44



Alloy rim F R, Scratch(es), Acceptable

0,00

No pictures to display

Bumper R, Scratch(es), Acceptable

0,00

No pictures to display

Door F L, Scratch(es), Acceptable

0,00

No pictures to display

Windscreen, Scratch(es), Acceptable

0,00

No pictures to display

Door trim R L, Scratch(es), E - Replace

114,00



Rearview mirror housing R, Scratch(es), Acceptable

0,00

No pictures to display

Bumper corner R R, Scratch(es), It - Spot repair

115,56



Door R L, Scratch(es), Acceptable

0,00

No pictures to display

Wing R R, Scratch(es), It - Spot repair

115,56

