



RENAULT Kangoo Express: 1FJK620

Vinnumber:	VF1FW58H549395466	Versionname:	KANGOO EXPR.MAXI Energy Gr.Conf.90PK
First Registrationdate:	16/07/2013	Fiscalpower:	
Expertise Mileage:	172851	Power Kw:	66
Bodytype:	Transporter	Body color:	Grey
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	NOT OK
Battery functioning:	Yes	Parking lot:	TRU12
Number of doors:	5		
Number of seats:	2		
Number head rests:	2		
Rims summer:	Steel		
Category:	Light Commercial Vehicle		
Oil level:	NOT OK		

Options

Windows electric F		Rear parking sensors
Radio multimedia		
Type of headlighting	Headlighting Halogen	
Type of GPS	No GPS	
Type of Lining	Lining fabrics	
Type of climate control	Manual climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	NOT OK	Sound engine	NOT OK
Engine startingtime	NOT OK	Clutch test	OK
Exhaust gass	NOT OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear


	195/65/15/95 T Steel			
Summer tyres:	Fr.L.	Goodyear: 5 mm	Fr.R.	Goodyear: 5 mm
	Re.L.	Goodyear: 5 mm	Re.R.	Goodyear: 5 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	------------	------	------------

Total cost ex VAT	1738,14
Bonnet, Dent(s), LI - Repair and paint (complete)	313,56



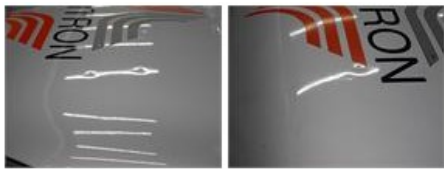

Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 231,15




Wing R R, Scratch(es), LI - Repair and paint (complete) 231,15



Bodywork, Not original part, Acceptable 0,00

No pictures to display

Wing F L, Scratch(es), LI - Repair and paint (complete) 165,13

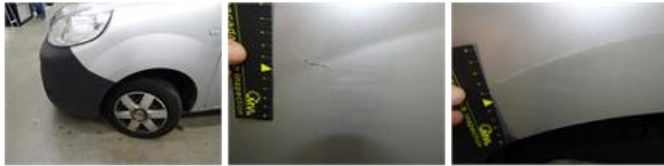

Tailgate, Dent(s) and scratch(es), LI - Repair and paint (complete) 362,02



Rearview mirror housing R, Broken, E - Replace 74,00



Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Dent(s), LI - Repair and paint (complete) 361,13

