



MERCEDES GLA: 1HUE897

Vinnumber:	WDC1569121J062955	Versionname:	GLA 180 CDI 109PK
First Registrationdate:	3/10/2014	Fiscalpower:	
Expertise Mileage:	135172	Power Kw:	80
Bodytype:	SUV	Body color:	Brown
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	4624
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	No Tow bar
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

215/60/17/96 V LightMetal				
Summer tyres:	Fr.L.	Bridgestone: 4 mm	Fr.R.	Bridgestone: 4 mm
	Re.L.	Bridgestone: 5 mm	Re.R.	Bridgestone: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	3034,15
-------------------	---------

Bumper F, Scratch(es), LI - Repair and paint (complete)	254,16
---	--------



Bumper moulding F R, Scratch(es), E - Replace

198,00




Door F L, Chemical polution, LI - Repair and paint (complete)

382,02




Door R R, Chemical polution, LI - Repair and paint (complete)

382,02

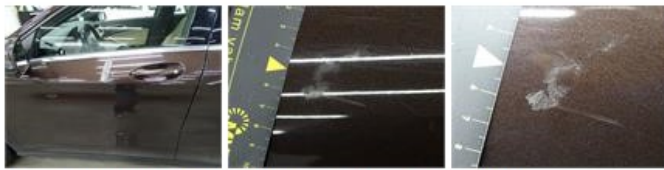


Bonnet, Chemical polution, LI - Repair and paint (complete)

348,09

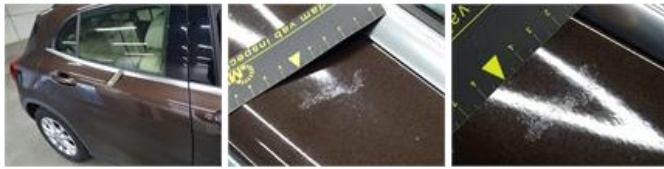

Bumper cover R M, Dent(s) and scratch(es), E - Replace

198,00

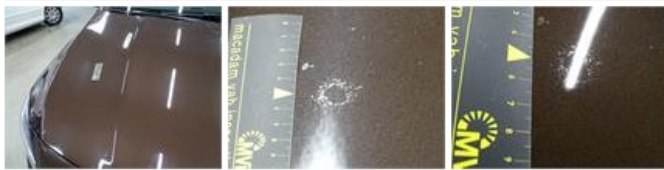

Door R L, Scratch(es), LI - Repair and paint (complete)

382,02



Certificate Of Conformity, Missing, E - Replace

150,00



Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00



Wing trim R L, Scratch(es), E - Replace 0,00



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 489,84



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim F L, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete) 0,00



Interior, Dirty, Acceptable 0,00

No pictures to display

Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Dent(s), Acceptable 0,00

No pictures to display

Boot cover, Broken, E - Replace 60,00

