



MERCEDES CLA: 1HNU875

Vinnumber:	WDD1173121N130535	Versionname:	CLA BER 180 CDI 109PK
First Registrationdate:	1/09/2014	Fiscalpower:	
Expertise Mileage:	137744	Power Kw:	80
Bodytype:	Berline	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	2312
Battery functioning:	Yes		
Number of doors:	4		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

GPS storage		Central consol F	
GPS storage	HD	Type of Tow bar	No Tow bar
Windows electric F			
Windows electric R			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining semi-artificial leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

205/55/16/91 M-S LightMetal			
Summer tyres:	Fr.L. Uniroyal: 5 mm	Fr.R. Uniroyal: 5 mm	
	Re.L. Michelin: 7 mm	Re.R. Michelin: 7 mm	

Assistance equipment

Spare wheel	No	Compressor	Yes
Emergency spare wheel	No	Jack	No
Repair kit	Yes	Runflat	No

Total cost ex VAT	2329,35
Door R R, Scratch(es), LI - Repair and paint (complete)	318,35

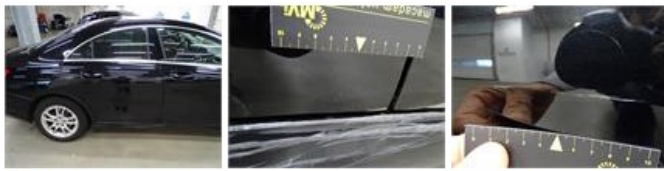

Bumper R, Deformed / Strained, LI - Repair and paint (complete)

307,80



Seat cover F L, Tear, Acceptable

0,00



Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20



Bonnet, Dent(s), PDR - Paintless dent repair

82,80



Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00



Bumper F, Scratch(es), Acceptable

0,00

No pictures to display

Tailgate, Scratch(es), Acceptable

0,00

No pictures to display

Door F L, Scratch(es), LI - Repair and paint (complete)

318,35



Seat cover F R, Stain, Cleaning

25,00



Sill outer R, Dent(s) and scratch(es), LI - Repair and paint (complete)	310,50
---	--------



Alloy rim F L, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------



Ignition key, Missing, E - Replace	150,00
------------------------------------	--------

