



BMW 3K11: 1SYS985

Vinnumber:	WBA3K11060K286028	Versionname:	318d stationwagen
First Registrationdate:	1/10/2014	Fiscalpower:	
Expertise Mileage:	197302	Power Kw:	105
Bodytype:		Body color:	Blue
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	4507
Maintenance:	IN 14000KM		
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Sun Roof electric	
GPS storage	HD	Panoramic roof	
GPS storage		Central consol F	
Windows electric F		Luggage cover	
Windows electric R		Front parking sensors	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional		Type of Tow bar	No Tow bar
Seats F heated			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/60/16/92 V LightMetal				
Summer tyres:	Fr.L.	Goodyear: 5 mm	Fr.R.	Goodyear: 5 mm
	Re.L.	Goodyear: 5 mm	Re.R.	Goodyear: 5 mm

Assistance equipment


	Runflat	Yes
--	---------	------------

Total cost ex VAT	993,55
-------------------	--------

Alloy rim F R, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Engine protective plate, Hole, E - Replace	35,00
--	-------

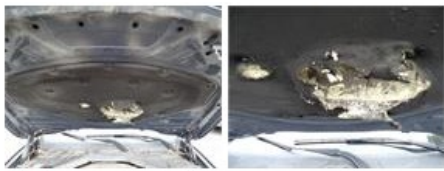

Door panel R R, Scratch(es), Smart repair

110,64



Bumper F, Scratch(es), Acceptable

0,00

No pictures to display

Door R R, Scratch(es), LI - Repair and paint (complete)

318,35



Door F R, Scratch(es), Acceptable

0,00

No pictures to display

Outer door handle F R, Scratch(es), Acceptable

0,00

No pictures to display

Door panel F R, Tear, E - Replace

114,00



Door R L, Dent(s), Acceptable

0,00

No pictures to display

Bumper R, Crack, LI - Repair and paint (complete)

211,80



Windscreen, Stone chip(s), Windscreen repair

88,20



Door frame F L, Scratch(es), It - Spot repair

115,56

