



FORD Grand C-Max: 1GXH11

Vinnumber:	WFOHXXWPBHET25842	Versionname:	GR.C-MAX Titanium St/St 115PK
First Registrationdate:	26/05/2014	Fiscalpower:	
Expertise Mileage:	101630	Power Kw:	85
Bodytype:	MPV	Body color:	Brown
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	4716
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Seats electric F L	
GPS storage	SD	Central consol F	
GPS storage		Luggage cover	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

215/55/16/93 V LightMetal				
Summer tyres:	Fr.L.	Michelin: 3 mm	Fr.R.	Michelin: 3 mm
	Re.L.	Uniroyal: 6 mm	Re.R.	Uniroyal: 6 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	------------	------	------------

Total cost ex VAT	738,95
Wing F L, Dent(s), Acceptable	0,00
<i>No pictures to display</i>	
Roof, Dent(s), PDR - Paintless dent repair	82,80



Alloy rim F R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door R L, Dent(s), Acceptable	0,00
<i>No pictures to display</i>	
Alloy rim R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Roof pillar R, Dent(s), PDR - Paintless dent repair	63,00




Door F L, Dent(s), LI - Repair and paint (complete)	318,35
---	--------



Bumper R, Scratch(es), LI - Repair and paint (complete)	211,80
---	--------



Roof pillar L, Dent(s), PDR - Paintless dent repair	63,00
---	-------

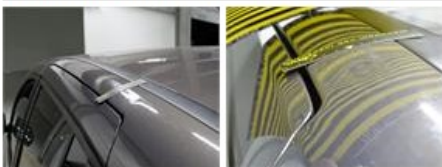

Trunk lid covering R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	