



MERCEDES B: 1GSS647

Vinnumber:	WDD2462121J254845	Versionname:	B 180CDI BE Edition 109PK
First Registrationdate:	17/04/2014	Fiscalpower:	
Expertise Mileage:	150524	Power Kw:	80
Bodytype:		Body color	Black
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Steel
Fueltype:	Diesel	Oil level	OK
Maintenance	OK	Parking lot	4126
Battery functioning	Yes		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Steel		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

GPS storage		Seats electric R	
GPS storage	HD	Central consol F	
Windows electric F		Luggage cover	
Windows electric R		Type of Tow bar	No Tow bar
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

Summer tyres:	195/65/15/91 V Steel			
	Fr.L.	Pirelli: 4 mm	Fr.R.	Pirelli: 4 mm
	Re.L.	Firestone: 7 mm	Re.R.	Firestone: 7 mm

Assistance equipment


Spare wheel	No	Compressor	Yes
Emergency spare wheel	No	Jack	No
Repair kit	Yes	Runflat	No

Total cost ex VAT	1814,22
Door R L, Scratch(es), Acceptable	0,00



Bonnet, Stone chip(s), LI - Repair and paint (complete)

290,08

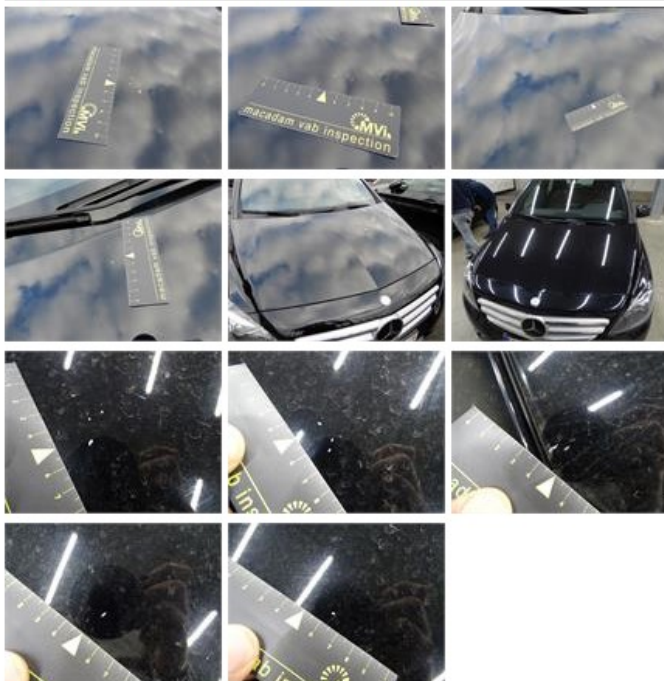

Tyre repair kit, Missing, E - Replace

210,53



Roof, Chemical polution, LI - Repair and paint (complete)

481,50



Bumper F, Scratch(es), It - Spot repair

115,56



Wing F L, Scratch(es), Acceptable

0,00



Wheel cover R R, Scratch(es), E - Replace

30,00



Door F L, Scratch(es), LI - Repair and paint (complete)

318,35



Door R R, Scratch(es), Acceptable

0,00



Wheel cover R L, Missing, E - Replace

30,00



Wheel cover F R, Scratch(es), E - Replace

30,00



Wing R L, Scratch(es), LI - Repair and paint (complete)

308,20



Door F R, Scratch(es), Acceptable

0,00

