


OPEL Astra: 1EJR753

Vinnnumber:	W0LPD6EA3D1045200	Versionname:	ASTRA BER ecoFLEX Enjoy S&S 95PK
First Registrationdate:	2/01/2013	Fiscalpower:	
Expertise Mileage:	152492	Power Kw:	70
Bodytype:	Hatchback	Body color:	Grey
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	4619
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	4		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		

Options

GPS storage	SD	Luggage cover	
GPS storage		Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	215/60/16/95 V Steel			
Summer tyres:	Fr.L.	Dunlop: 5 mm	Fr.R.	Dunlop: 5 mm
	Re.L.	Continental: 7 mm	Re.R.	Continental: 7 mm

Assistance equipment

Spare wheel	No	Compressor	No
Emergency spare wheel	Yes	Jack	Yes
Repair kit	No	Runflat	No

Total cost ex VAT	716,60
Grill frame, Broken, E - Replace	171,00



Bumper F, Dent(s) and scratch(es), LI - Repair and paint (complete)

211,80



Wheel cover F R, Scratch(es), Acceptable

0,00

No pictures to display



Inner door handle F L, Scratch(es), E - Replace

36,00



Wing R L, Bad repair, LI - Repair and paint (complete)

0,00

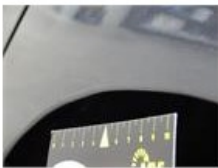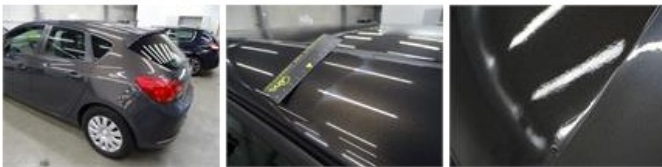

Wing R R, Bad repair, LI - Repair and paint (complete)

0,00



Rearview mirror housing R, Scratch(es), Acceptable

0,00

No pictures to display

Inner door handle F R, Scratch(es), E - Replace

36,00



Door R R, Bad repair, LI - Repair and paint (complete)

0,00



Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)

261,80





Door F R, Dent(s), Acceptable

0,00

No pictures to display