



81036 KM

Kilometerteller is vervangen
L'odomètre a été remplacé
Odometer has been replaced

RENAULT Trafic: 1ASH960

Vinnumber:	VF1FLBMB6BY380608	Versionname:	TRAFIC 29 B/F MWB L2H1 Gr.Conf.90PK
First Registrationdate:	15/03/2011	Fiscalpower:	
Expertise Mileage:	81036	Power Kw:	66
Bodytype:	Transporter	Body color:	White
Gearbox:	MAN 6 VIT	Paint type:	Opaque
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3514
Number of doors:	5		
Number of seats:	3		
Number head rests:	3		
Rims summer:	Steel		
Category:	Light Commercial Vehicle		
Oil level:	OK		

Options

Radio CD		Rear parking sensors	
Windows electric F		Type of Tow bar	Tow bar fixed
Type of headlighting	Headlighting Halogen		
Type of GPS	No GPS		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/65/16/105 T Steel			
Summer tyres:	Fr.L.	Kleber: 3 mm	Fr.R.	Kleber: 3 mm
	Re.L.	Kleber: 4 mm	Re.R.	Kleber: 4 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	-----	------	-----


Total cost ex VAT	307,65
Trunk door R L, Dent(s) and scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Bumper F, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Sliding door R, Dent(s), PDR - Paintless dent repair	63,00



Bodywork, Not original part, Acceptable 0,00

No pictures to display

Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 231,15

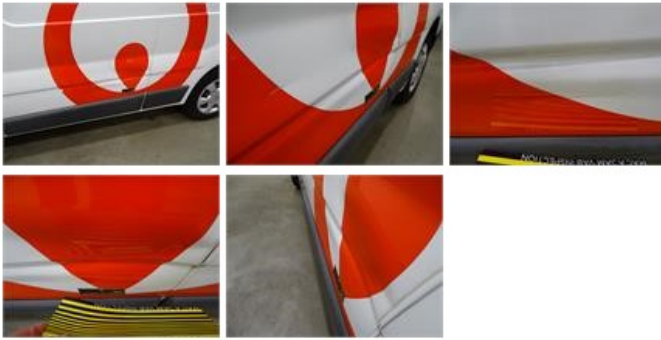

Rearview mirror glass R, Missing, E - Replace 13,50



Trunk door R R, Dent(s), Acceptable 0,00

No pictures to display

Sill outer L, Scratch(es), Acceptable 0,00

No pictures to display

Instrument panel complete, No damage, No repair 0,00



81036 KM

Kilometerteller is vervangen
L'odomètre a été remplacé
Odometer has been replaced