



RENAULT CLIO: 1KAR659

Vinnumber:	VF15RJL0H52519257	Versionname:	1.5 ENERGY DCI 90E EXPRESSION
First Registrationdate:	20/03/2015	Fiscalpower:	
Expertise Mileage:	71437	Power Kw:	66
Bodytype:	Hatchback	Body color:	Grey
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Maintenance:	NOT OK	Parking lot:	3821
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

GPS storage		Luggage cover	
GPS storage	HD	Rear parking sensors	
Windows electric F		Type of Tow bar	No Tow bar
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

185/65/15/92 T Steel				
Summer tyres:	Fr.L.	Michelin: 3 mm	Fr.R.	Michelin: 3 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT 2492,03

Wing F R, Crack, Le - Replace and paint 448,01



Bumper R, Dent(s) and scratch(es), Le - Replace and paint 535,20



Interior, Dirty, Cleaning 100,00



Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Scratch(es), Acceptable 0,00

No pictures to display

Sill outer R, Dent(s) and scratch(es), LI - Repair and paint (complete) 248,40



Wing F L, Scratch(es), LI - Repair and paint (complete) 176,14



Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 254,68




Bumper F, Dent(s) and scratch(es), Le - Replace and paint

607,20



Bonnet, Dent(s), PDR - Paintless dent repair

122,40

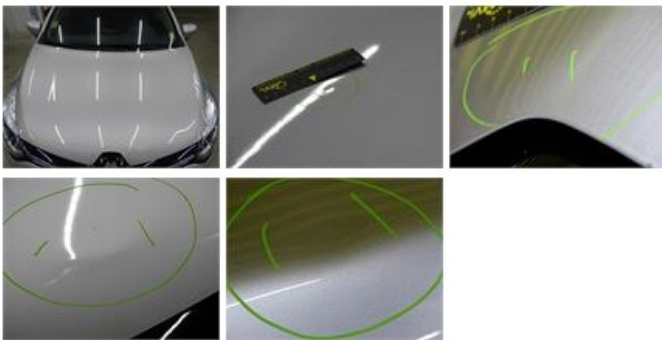

Maintenance, Maintenance, Execute

0,00

No pictures to display