



VOLKSWAGEN Golf: AJ0787

Vinnumber:	WVWZZZAUZFP033962	Versionname:	GOLF BER Highline DSG 105PK Aut.
First Registrationdate:	21/10/2014	Fiscalpower:	
Expertise Mileage:	137859	Power Kw:	77
Bodytype:	Hatchback	Body color:	Black
Gearbox:	Automatic	Paint type:	Metallic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance	TEMOIN MOTEUR : T BORD	Parking lot:	3731
Maintenance	NOT OK		
Battery functioning	Yes		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD		Seats electric F L
GPS storage	SD	Central consol F
GPS storage		Luggage cover
Windows electric F		Front parking sensors
Windows electric R		Rear parking sensors
Cruise Control		
Steering wheel multifunctional		
Seats F heated		
Radio multimedia		
Type of headlighting	Headlighting Xenon	
Type of GPS	GPS big screen color	
Type of Lining	Lining leather	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/45/17/94 V LightMetal				
Summer tyres:	Fr.L.	Kleber: 6 mm	Fr.R.	Kleber: 6 mm
	Re.L.	Kleber: 6 mm	Re.R.	Kleber: 6 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	------------	------	------------

Total cost ex VAT	2246,63
--------------------------	----------------

Wing R R, Dent(s), PDR - Paintless dent repair	63,00
---	--------------



Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete)

95,00



Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete)

95,00



Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete)

95,00



Bumper F, Dent(s), LI - Repair and paint (complete)

259,80



Bonnet, Scratch(es), Acceptable

0,00

No pictures to display

Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete)

95,00



Door R R, Scratch(es), LI - Repair and paint (complete)

318,35



Wing F R, Dent(s), LI - Repair and paint (complete)

268,18



Windscreen, Stone chip(s), Windscreen repair 58,80




Wing R L, Scratch(es), Acceptable 0,00

No pictures to display

Maintenance, Maintenance, Execute 0,00

No pictures to display

Door F R, Scratch(es), LI - Repair and paint (complete) 318,35

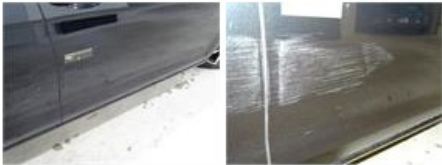

Mats, Dirty, Forfeit 50,00



Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete) 318,35

