



FORD Transit 350L: 784BVX

Vinnumber:	WF0NXXTTFNAU55628	Versionname:	TRANSIT CH2C 350L EF LWB 115pk
First Registrationdate:	15/07/2010	Fiscalpower:	
Expertise Mileage:	166570	Power Kw:	85
Bodytype:	Transporter	Body color:	White
Gearbox:	MAN 5 VIT	Paint type:	Opaque
Transmission:	Back	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	LCV15
Number of doors:	4		
Number of seats:	6		
Number head rests:	6		
Rims summer:	Steel		
Category:	Light Commercial Vehicle		
Oil level:	OK		

Options

Radio CD	Type of Tow bar	No Tow bar
Windows electric F		
Steering wheel multifunctional		
Type of headlighting	Headlighting Halogen	
Type of GPS	No GPS	
Type of Lining	Lining artificial leather	
Type of climate control	No climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

185/75/16/104 R LightMetal				
Summer tyres:	Fr.L.	Continental: 6 mm	Fr.R.	Continental: 6 mm
	Re.L.	Continental: 7 mm	Re.R.	Continental: 7 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT	1633,54
-------------------	----------------

Bodywork, Glue residues, Remove lettering	0,00
---	-------------

No pictures to display

Rearview mirror glass R, Missing, E - Replace	13,50
---	--------------




Central pillar L, Rust, LI - Repair and paint (complete)



Door trim R R, Deformed / Strained, E - Replace 91,50



Central pillar R, Rust, LI - Repair and paint (complete) 366,49

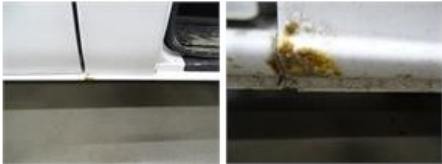

Bumper F R, Scratch(es), E - Replace 271,00



Windscreen, Stone chip(s), Windscreen repair 58,80



Sill outer R, Rust, LI - Repair and paint (complete) 232,88



Sill outer L, Rust, LI - Repair and paint (complete) 232,88

