



MERCEDES A: 1KXL795

Vinnumber:	WDD1760121V076501	Versionname:	1.5 A 180 CDI
First Registrationdate:	24/07/2015	Fiscalpower:	
Expertise Mileage:	64223	Power Kw:	80
Bodytype:		Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3118
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Type of Tow bar	No Tow bar
Windows electric F			
Windows electric R			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

195/65/15/95 V LightMetal				
Winter tyres:	Fr.L.	Michelin: 2 mm	Fr.R.	Michelin: 2 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	695,32
Sill outer R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Roof, Dent(s), PDR - Paintless dent repair	63,00

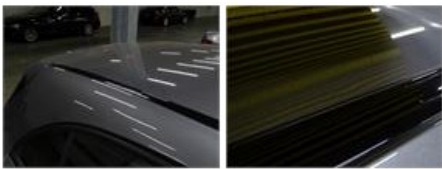

Wing F R, Dent(s), PDR - Paintless dent repair 63,00



Bumper F R, Scratch(es), It - Spot repair 115,56



Wheel cover F R, Scratch(es), E - Replace 30,00



Wheel cover R L, Scratch(es), Acceptable 0,00

No pictures to display

Bumper corner R R, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Dent(s) and scratch(es), It - Spot repair 115,56



Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Scratch(es), LI - Repair and paint (complete) 308,20

