



**OPEL Insignia: 1EAK212**

Vinnumber:	<b>WOLGT8EL9D1015943</b>	Versionname:	<b>INSIGNIA BRE ecofl.Cosmo S/S DPF 130PK</b>
First Registrationdate:	<b>3/10/2012</b>	Fiscalpower:	
Expertise Mileage:	<b>169418</b>	Power Kw:	<b>96</b>
Bodytype:	<b>Break</b>	Body color:	<b>Dark Blue</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metallic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>1116</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		

**Options**

Radio CD	Seats F L ventilated
Windows electric F	Seats F R ventilated
Windows electric R	Central consol F
Cruise Control	Luggage cover
Steering wheel multifunctional	Front parking sensors
Seats F heated	Rear parking sensors
Radio multimedia	
Type of headlighting	<b>Headlighting Xenon</b>
Type of GPS	<b>GPS big screen color</b>
Type of Lining	<b>Lining leather</b>
Type of climate control	<b>Autom climate control</b>

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>245/45/18/100 V LightMetal</b>			
Winter tyres:	Fr.L.	<b>Bridgestone: 3 mm</b>	Fr.R.	<b>Bridgestone: 3 mm</b>
	Re.L.	<b>Bridgestone: 4 mm</b>	Re.R.	<b>Bridgestone: 4 mm</b>

**Assistance equipment**

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
------------	------------	------------	------------

Total cost ex VAT 3579,61


Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80





Wing R L, Scratch(es), LI - Repair and paint (complete)

308,20

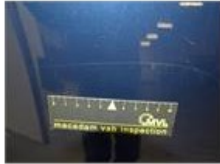

Interior, Smell, Ozone treatment

152,58



Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80




Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

308,20

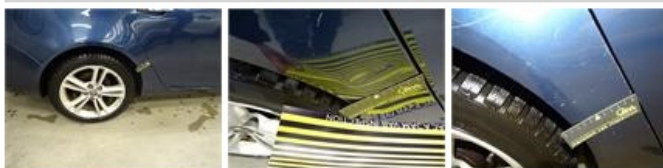

Door F L, Dent(s), LI - Repair and paint (complete)

318,35



Alloy rim R L, Scratch(es), LI - Repair and paint (complete)

95,00



Door F R, Scratch(es), Acceptable 0,00

*No pictures to display*

Door R L, Scratch(es), LI - Repair and paint (complete) 318,35



Alloy rim F R, Scratch(es), E - Replace 235,20



Door R R, Scratch(es), LI - Repair and paint (complete) 318,35



Alloy rim F L, Scratch(es), E - Replace 235,20



Bonnet, Chemical polution, LI - Repair and paint (complete) 290,08



Roof, Scratch(es), LI - Repair and paint (complete) 481,50

