



VOLKSWAGEN GOLF VII: KJ0501

Vinnumber:	WVWZZZAUZFP086900	Versionname:	1.6 TDI 77KW DSG BMT HIGHLINE
First Registrationdate:	21/03/2015	Fiscalpower:	
Expertise Mileage:	101140	Power Kw:	77
Bodytype:		Body color:	Black
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3432
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Seats electric F L	
GPS storage	SD	Central consol F	
GPS storage		Luggage cover	
Windows electric F		Front parking sensors	
Windows electric R		Rear parking sensors	
Cruise Control		Type of Tow bar	No Tow bar
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		
Adaptive cruise control			
Sport seats			

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/45/17/91 W LightMetal			
Summer tyres:	Fr.L. Pirelli: 6 mm	Fr.R. Pirelli: 6 mm	
	Re.L. Goodyear: 7 mm	Re.R. Goodyear: 7 mm	

Assistance equipment

Total cost ex VAT	2716,60
Bumper F R, Scratch(es), It - Spot repair	115,56



Door F R, Dent(s), PDR - Paintless dent repair

63,00



Wing R L, Scratch(es), LI - Repair and paint (complete)

308,20



Rearview mirror R complete, Broken, Le - Replace and paint

283,00



Door R L, Scratch(es), LI - Repair and paint (complete)

318,35




Bonnet, Chemical pollution, LI - Repair and paint (complete)

290,08



Bumper R, Scratch(es), It - Spot repair

115,56

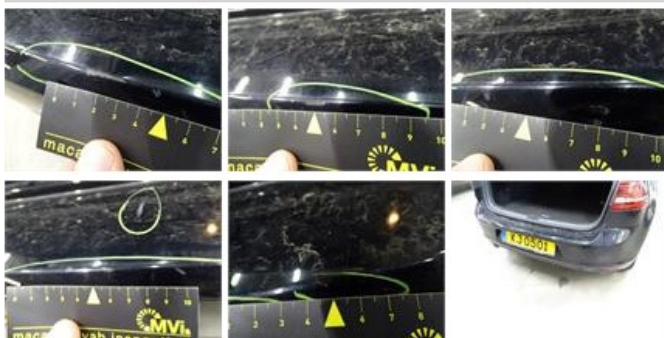

Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete)

95,00



Door R R, Scratch(es), Acceptable

0,00

No pictures to display

Certificate Of Conformity, Missing, E - Replace

150,00

No pictures to display

Sill outer R, Dent(s), PDR - Paintless dent repair

159,00



Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Door F L, Scratch(es), LI - Repair and paint (complete) 318,35



Roof, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Sill outer L, Dent(s) and scratch(es), LI - Repair and paint (complete) 310,50

