



BMW 3: 1FXC371

Vinnumber:	WBA3D11050J851823	Versionname:	3 BER 318dA 136PK Aut.
First Registrationdate:	25/11/2013	Fiscalpower:	
Expertise Mileage:	178485	Power Kw:	100
Bodytype:	Berline	Body color:	Blue
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	NOT OK	Parking lot:	1427
Maintenance:	TO DO		
Battery functioning:	Yes		
Number of doors:	4		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F
GPS storage	HD	Rear parking sensors
GPS storage		
Windows electric F		
Windows electric R		
Cruise Control		
Radio multimedia		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining artificial leather	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/60/16/96 V LightMetal				
Summer tyres:	Fr.L.	Michelin: 3 mm	Fr.R.	Michelin: 3 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	852,91
-------------------	---------------

Wing R L, Scratch(es), Acceptable	0,00
-----------------------------------	-------------

<i>No pictures to display</i>	
-------------------------------	--

Foglight R, Broken, E - Replace	138,00
---------------------------------	---------------



Maintenance, Maintenance, Execute 0,00

No pictures to display

Door panel F R, Tear, E - Replace 114,00




Alloy rim F R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Door F L, Dent(s), LI - Repair and paint (complete) 390,35

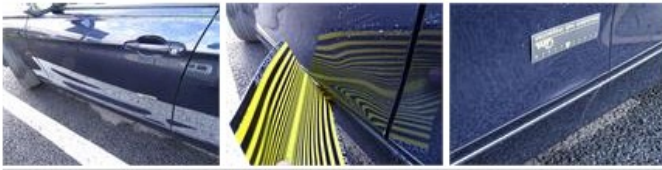

Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Windscreen, Stone chip(s), Acceptable 0,00

No pictures to display

Seat cover F L, Worn, Acceptable 0,00



Bumper F L, Scratch(es), It - Spot repair 115,56

