


PEUGEOT 2008; 1HHU102

Vinnumber:	VF3CU8HR0EY003833	Versionname:	2008 Active 68PK
First Registrationdate:	28/07/2014	Fiscalpower:	
Expertise Mileage:	111970	Power Kw:	50
Bodytype:		Body color:	Dark Grey
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1310
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Windows electric F		Luggage cover	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional		Type of Tow bar	No Tow bar
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection


Airco functioning	OK	Battery functioning	Yes
Tires wear profile	NOT OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	195/60/16/89 H Steel			
Summer tyres:	Fr.L.	Goodyear: 2 mm	Fr.R.	Goodyear: 2 mm
	Re.L.	Goodyear: 4 mm	Re.R.	Goodyear: 4 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
Total cost ex VAT			591,35
Bumper R, Scratch(es), Acceptable			0,00
<i>No pictures to display</i>			
Tailgate, Scratch(es), Acceptable			0,00
<i>No pictures to display</i>			
Bonnet, Stone chip(s), Acceptable			0,00
<i>No pictures to display</i>			
Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)			318,35

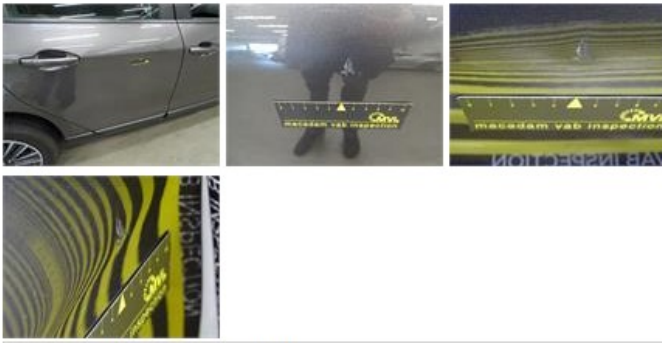

Wheel cover R R, Broken, E - Replace 30,00



Wheel cover F R, Scratch(es), E - Replace 30,00



Wheel cover F L, Scratch(es), Acceptable 0,00

No pictures to display

Ignition key, Missing, E - Replace 150,00

No pictures to display

Wing R R, Dent(s), PDR - Paintless dent repair 63,00

