


SKODA Octavia: 1HCB320

Vinnumber:	TMBJG9NE2E0192635	Versionname:	OCTAVIA COMBI Elegance 105PK
First Registrationdate:	16/06/2014	Fiscalpower:	
Expertise Mileage:	156113	Power Kw:	77
Bodytype:		Body color	Red
Gearbox:	MAN 5 VIT	Paint type	Metallic
Transmission:	Front	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	4509
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD		Seats electric F L	
GPS storage	SD	Central consol F	
GPS storage		Luggage cover	
Windows electric F		Front parking sensors	
Windows electric R		Rear parking sensors	
Cruise Control		Type of Tow bar	No Tow bar
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining semi-leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	NOT OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

Summer tyres:	225/45/17/91 Y LightMetal			
	Fr.L.	Michelin: 6 mm	Fr.R.	Michelin: 6 mm
	Re.L.	Kleber: 7 mm	Re.R.	Kleber: 7 mm

Assistance equipment


Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT	3425,69
Roof, Chemical polution, LI - Repair and paint (complete)	481,50



Alloy Rims (all), Scratch(es), LI - Repair and paint (complete)

380,00

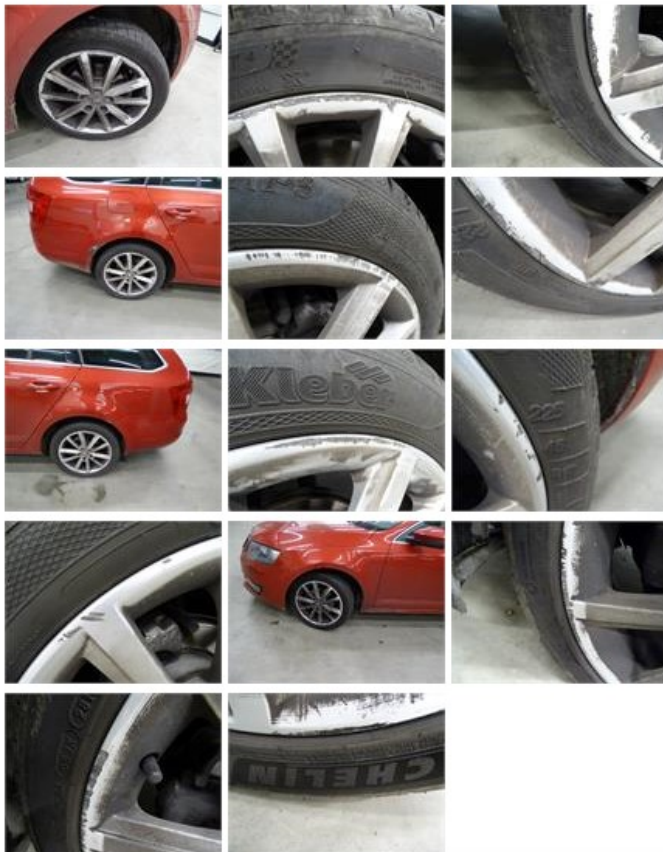

Rear window, Scratch(es), E - Replace

0,00



Bonnet, Chemical polution, LI - Repair and paint (complete)

290,08



Door F L, Scratch(es), It - Spot repair

115,56



Door R R, Scratch(es), LI - Repair and paint (complete)

318,35





Wing R R, Dent(s), PDR - Paintless dent repair	142,20
--	--------



Tailgate, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Bumper R, Dent(s) and scratch(es), Le - Replace and paint	651,00
---	--------



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)	308,20
---	--------



Interior, Dirty, Cleaning	125,00
---------------------------	--------



Ignition key, Missing, E - Replace	150,00
------------------------------------	--------

No pictures to display

Floor covering F L - Tear, E - Replace	252,00
--	--------

Floor covering L, Repair & Replace		202,00
 		
Bumper F, Scratch(es), LI - Repair and paint (complete)		211,80
     		
Sill outer L, Dent(s) and scratch(es), Le - Replace and paint		0,00
 		