



VOLVO V40: 1HXJ322

Vinnumber:	YV1MV8481F2204079	Versionname:	V40 D2 Base 115PK
First Registrationdate:	21/10/2014	Fiscalpower:	
Expertise Mileage:	55841	Power Kw:	84
Bodytype:	Hatchback	Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metallic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3724
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Cruise Control	Type of Tow bar
Steering wheel multifunctional	No Tow bar
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Manual climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear


Summer tyres:	205/55/16/91 H LightMetal			
	Fr.L.	Kleber: 4 mm	Fr.R.	Kleber: 4 mm
	Re.L.	Kleber: 5 mm	Re.R.	Kleber: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
Total cost ex VAT			905,10
Alloy rim R R, Scratch(es), Acceptable			0,00
No pictures to display			
Bumper R, Scratch(es), LI - Repair and paint (complete)			211,80



Roof, Chemical polution, LI - Repair and paint (complete)	481,50
---	--------

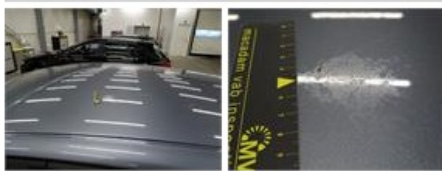

Bumper F, Scratch(es), LI - Repair and paint (complete)	211,80
---	--------



Alloy rim R L, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Alloy rim F R, Scratch(es), Acceptable	0,00
--	------

No pictures to display