



MERCEDES Sprinter 200: 1DXK877

Vinnumber:	WDB90661315697637	Versionname:	SPRINTER 213 3000kg B/F A2 129PK
First Registrationdate:	26/09/2012	Fiscalpower:	
Expertise Mileage:	53668	Power Kw:	95
Bodytype:	Transporter	Body color:	White
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	LCV15
Number of doors:	5		
Number of seats:	3		
Number head rests:	3		
Rims summer:	Steel		
Category:	Light Commercial Vehicle		
Oil level:	OK		

Options

Radio CD		Central consol F	
Windows electric F		Type of Tow bar	No Tow bar
Type of headlighting	Headlighting Halogen		
Type of GPS	No GPS		
Type of Lining	Lining fabrics		
Type of climate control	No climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/75/16/110 R Steel				
Summer tyres:	Fr.L.	Michelin: 7 mm	Fr.R.	Michelin: 7 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment

Spare wheel	Yes
-------------	------------

Total cost ex VAT	1652,86
-------------------	---------

Maintenance book, Missing, E - Replace	0,00
--	------

No pictures to display

Trunk door R L, Dent(s) and scratch(es), It - Spot repair	115,56
---	--------






Spare wheel compartment lining R R, Dent(s), Smart repair

110,64



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

231,15

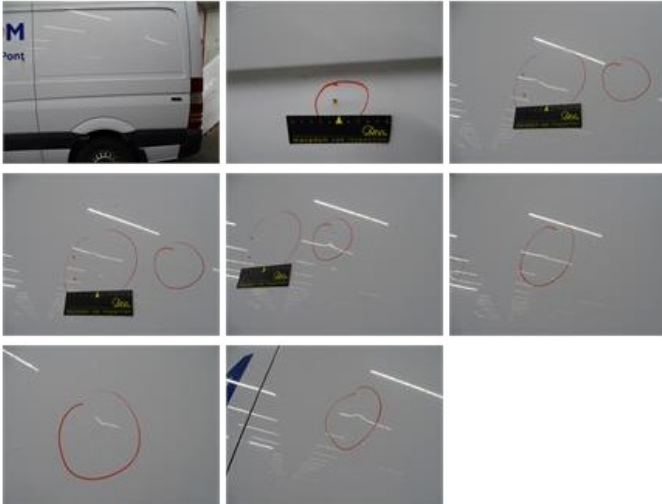

Bumper F, Broken, Smart repair

110,64



Ignition key, Missing, E - Replace

150,00

No pictures to display

Spare wheel compartment lining R L, Dent(s), Smart repair

110,64



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

238,76



Trunk door R R, Dent(s) and scratch(es), It - Spot repair


115,56





Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

238,76

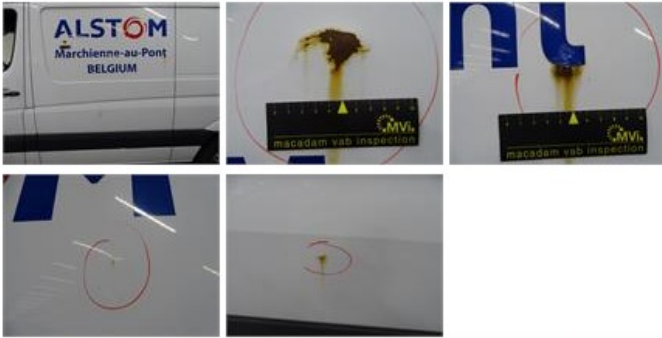

Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

231,15

