



BMW 3 TOURING: 1JEJ105

Vinnumber:	WBA3K11040K287677	Versionname:	2.0 318D (100KW) TOURING
First Registrationdate:	25/11/2014	Fiscalpower:	
Expertise Mileage:	109223	Power Kw:	100
Bodytype:	Break	Body color:	Brown
Gearbox:	Automatic	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2726
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F	
Windows electric F	Luggage cover	
Windows electric R	Rear parking sensors	
Cruise Control	Type of Tow bar	Tow bar fixed
Steering wheel multifunctional		
Seats F heated		
Radio multimedia		
Type of headlighting	Headlighting Xenon	
Type of GPS	GPS big screen color	
Type of Lining	Lining leather	
Type of climate control	Autom climate control	

Limited Technical Inspection


Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

225/50/17/94 H LightMetal				
Winter tyres:	Fr.L.	Bridgestone: 6 mm	Fr.R.	Bridgestone: 6 mm
	Re.L.	Bridgestone: 7 mm	Re.R.	Bridgestone: 7 mm

Assistance equipment

Total cost ex VAT	1473,65
Rear window, Scratch(es), E - Replace	0,00

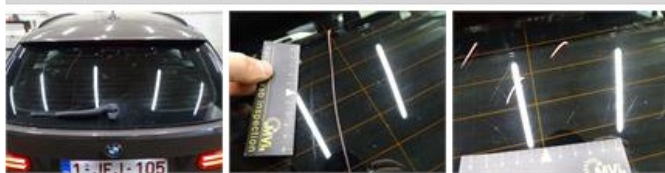

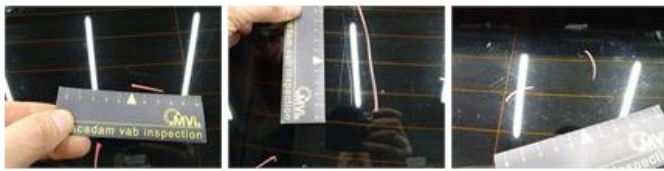

Door F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Bumper F, Scratch(es), LI - Repair and paint (complete)

211,80



Alloy rim R L, Scratch(es), LI - Repair and paint (complete)

95,00



Bumper R, Dent(s) and scratch(es), LI - Repair and paint (complete)

211,80



Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

318,35



Door R R, Dent(s), LI - Repair and paint (complete)

318,35

