



PEUGEOT BOXER: 1VFT756

Vinnumber:	VF3YC3MFC12J14042	Versionname:	
First Registrationdate:	25/10/2018	Fiscalpower:	
Expertise Mileage:	27156	Power Kw:	120
Bodytype:	Transporter	Body color:	White
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	TRU13
Number of doors:	5		
Number of seats:	3		
Number head rests:	3		
Rims summer:	Steel		
Category:	Light Commercial Vehicle		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	Rear parking sensors
Cruise Control	Type of Tow bar
Steering wheel multifunctional	No Tow bar
Type of headlighting	Headlighting Halogen
Type of GPS	No GPS
Type of Lining	Lining fabrics
Type of climate control	Manual climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

215/70/15/109 S Steel				
Summer tyres:	Fr.L.	Continental: 4 mm	Fr.R.	Continental: 4 mm
	Re.L.	Continental: 8 mm	Re.R.	Continental: 8 mm

Assistance equipment

Spare wheel	Yes
-------------	------------

Total cost ex VAT	3194,13
-------------------	---------

Wing trim R L, Scratch(es), E - Replace	69,00
---	-------



Door R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

238,76



Interior, Dirty, Cleaning

50,00



Door moulding Lower R L, Scratch(es), E - Replace

91,50



Rearview mirror housing L, Scratch(es), Smart repair

110,64




Rearview mirror R complete, Broken, E - Replace

138,00



Door R L, Dent(s) and scratch(es), LI - Repair and paint (complete)

238,76

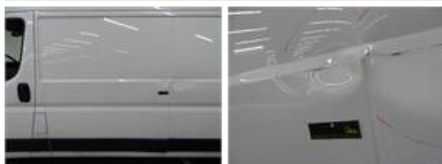

Trunk door R R, Dent(s) and scratch(es), It - Spot repair

115,56



Ignition key, Missing, E - Replace

150,00

No pictures to display


Bonnet, Scratch(es), LI - Repair and paint (complete)

217,56

No pictures to display

Roof pillar R, Scratch(es), LI - Repair and paint (complete)

165,14

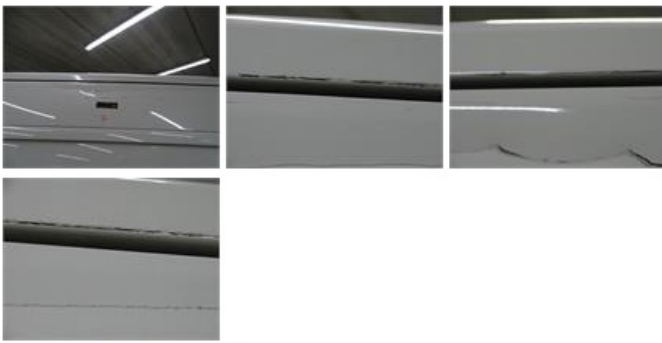

Headlight L, Broken, E - Replace 321,00



Bumper F, Deformed / Strained, E - Replace 398,40



Wing F L, Bad repair, Le - Replace and paint 427,51



Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 231,15



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete) 231,15

