



SKODA Superb: 1AHL103

Vinnumber:	TMBAJ73T1B9038268	Versionname:	SUPERB BER Classic DPF 105PK
First Registrationdate:	11/01/2011	Fiscalpower:	
Expertise Mileage:	91554	Power Kw:	77
Bodytype:	Hatchback	Body color:	Grey
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3707
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	No Tow bar
Steering wheel multifunctional			
Type of headlighting	Headlighting Halogen		
Type of GPS	No GPS		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/94 V Steel			
Summer tyres:	Fr.L.	Bridgestone: 7 mm	Fr.R.	Bridgestone: 7 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	843,00
--------------------------	---------------

Wheel cover F L, Scratch(es), E - Replace	36,00
--	--------------





Rearview mirror housing L, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Bumper R, Scratch(es), LI - Repair and paint (complete)	254,16
---	--------



Wing R L, Scratch(es), LI - Repair and paint (complete)	369,84
---	--------



Wheel cover R R, Scratch(es), E - Replace	36,00
---	-------



Wheel cover R L, Scratch(es), E - Replace	36,00
---	-------




Wing F R, Bad repair, LI - Repair and paint (complete)	0,00
--	------



Bumper F, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Bonnet, Hail damage, PDR - Hail	0,00
---------------------------------	------

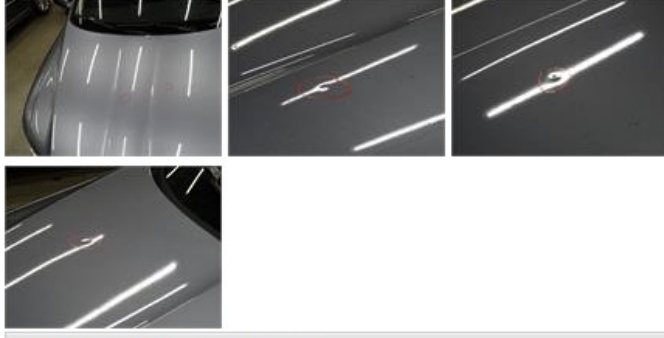

Roof pillar L, Hail damage, PDR - Hail	25,00
--	-------




Roof, Hail damage, PDR - Hail	0,00
-------------------------------	------



Door R R, Bad repair, Paint 0,00



Tailgate, Hail damage, PDR - Hail 50,00

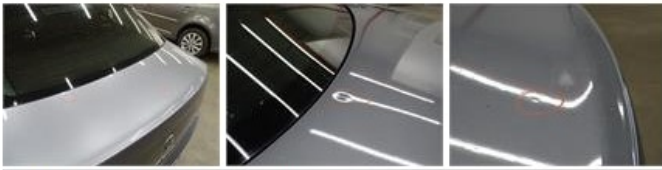

Wheel cover F R, Broken, E - Replace 36,00



Door F R, Bad repair, Paint 0,00

