



OPEL Movano 3500 MWB Med.High Roof: 1GDZ640

Vinnumber:	WOLMRFESCEB049638	Versionname:	MOVANO 3500 B/F L2H2 ecoFL.(E5)125PK
First Registrationdate:	13/01/2014	Fiscalpower:	
Expertise Mileage:	253262	Power Kw:	92
Bodytype:		Body color:	Red
Gearbox:	MAN 6 VIT	Paint type:	Opaque
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	LCV23
Number of doors:	5		
Number of seats:	3		
Number head rests:	3		
Rims summer:	Steel		
Category:	Light Commercial Vehicle		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	
Type of headlighting	Headlighting Halogen
Type of Lining	Lining fabrics
Type of climate control	Manual climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	NOT OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/65/16/16 C Steel				
Winter tyres:	Fr.L.	Uniroyal: 3 mm	Fr.R.	Uniroyal: 3 mm
	Re.L.	Kleber: 3 mm	Re.R.	Kleber: 3 mm

Assistance equipment

Total cost ex VAT	2787,48
Rearview mirror R complete, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Mirror side blinker R, Broken, E - Replace	28,50



Wing F R, Scratch(es), LI - Repair and paint (complete)	165,13
---	--------



Air vent mid-dashboard, Broken, Forfeit

153,00



Wing F L, Deformed / Strained, LI - Repair and paint (complete)

165,13



Wheel cover R R, Scratch(es), E - Replace

22,50



Central pillar R, Dent(s) and scratch(es), It - Spot repair

115,56



Door moulding Lower R R, Scratch(es), E - Replace

91,50



Spare wheel, Deformed / Strained, E - Replace

153,60



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

327,15



Door F L, Dent(s), Acceptable

0,00



Seat cover F L, Worn, Acceptable

0,00



Outer door handle R R, Missing, E - Replace

78,65



Sill outer R, Dent(s) and scratch(es), Le - Replace and paint

546,00




Windscreen, Broken, E - Replace

0,00




Bumper F, Hole, E - Replace

398,40

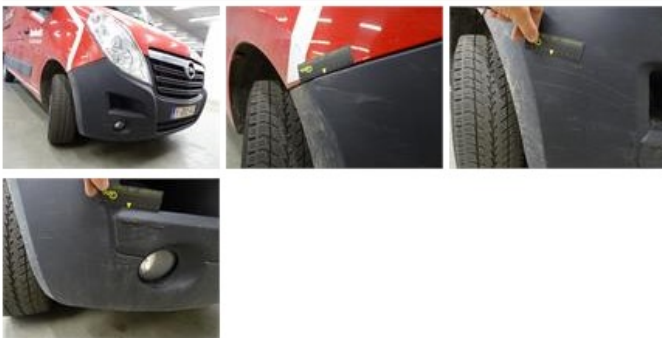

Interior, Dirty, Cleaning

0,00

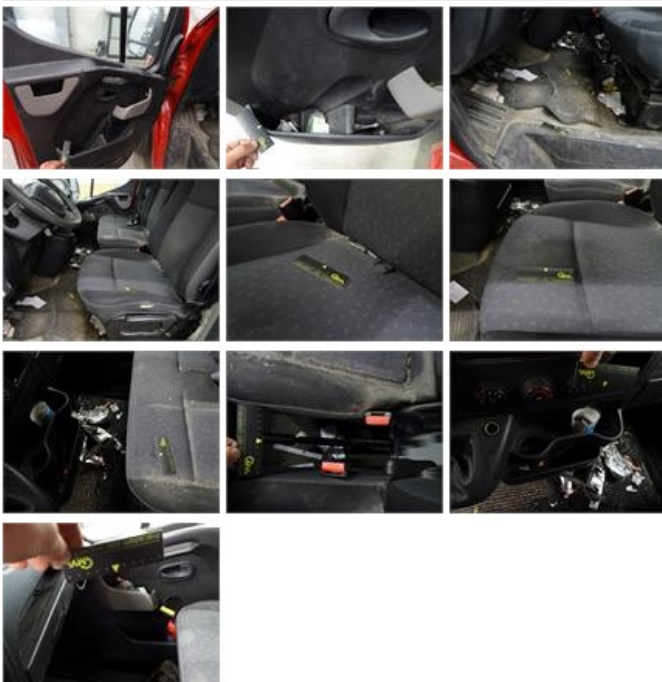

Door R R, Dent(s), LI - Repair and paint (complete)

238,76





Ignition key, Missing, E - Replace 150,00



Spare wheel, Missing, E - Replace 153,60



Bonnet, Dent(s), Acceptable 0,00

No pictures to display