



BMW 3: 1GEN330			
Vinnumber:	WBA3K110X0F829695	Versionname:	3 TOURING 318d 136PK
First Registrationdate:	16/01/2014	Fiscalpower:	
Expertise Mileage:	176590	Power Kw:	100
Bodytype:	Break	Body color:	Brown
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3523
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options			
Radio CD		Central consol F	
Windows electric F		Luggage cover	
Windows electric R		Rear parking sensors	
Cruise Control		Type of Tow bar	No Tow bar
Steering wheel multifunctional			
Seats F heated			
Radio multimedia			
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining artificial leather		
Type of climate control	Autom climate control		

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	225/45/18/95 V LightMetal			
Winter tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment	
Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Total cost ex VAT	479,40
Bumper moulding F R, Crack, E - Replace	14,40




Alloy rim R L polished, Rust, Acceptable	0,00
--	------

No pictures to display

Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete)	95,00
---	-------



Rear window, Scratch(es), E - Replace	370,00
---------------------------------------	--------

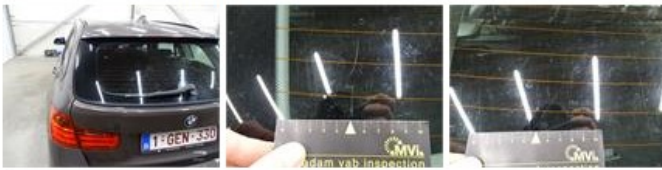

Bumper R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Alloy rim R R polished, Rust, Acceptable	0,00
--	------

No pictures to display

Alloy rim F L polished, Scratch(es), Acceptable	0,00
---	------

No pictures to display