



**RENAULT Kangoo Express: 1FXK830**

Vinnumber:	<b>VF1FW15H449869639</b>	Versionname:	<b>KANGOO EXPR.MAXI Access Gr.Conf.90PK</b>
First Registrationdate:	<b>27/11/2013</b>	Fiscalpower:	
Expertise Mileage:	<b>117334</b>	Power Kw:	<b>66</b>
Bodytype:	<b>Transporter</b>	Body color:	<b>White</b>
Gearbox:	<b>MAN 5 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:		Rims summer:	<b>Steel</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>2226</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>3</b>		
Number head rests:	<b>3</b>		
Rims summer:	<b>Steel</b>		
Category:	<b>Light Commercial Vehicle</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Windows electric F		Type of Tow bar	<b>No Tow bar</b>
Radio multimedia			
Type of headlighting	<b>Headlighting Halogen</b>		
Type of GPS	<b>No GPS</b>		
Type of Lining	<b>Lining fabrics</b>		
Type of climate control	<b>Manual climate control</b>		

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>NOT OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>195/65/15/95 T Steel</b>			
Winter tyres:	Fr.L.	<b>Kleber: 5 mm</b>	Fr.R.	<b>Kleber: 5 mm</b>
	Re.L.	<b>Kleber: 5 mm</b>	Re.R.	<b>Kleber: 5 mm</b>

**Assistance equipment**

Spare wheel	<b>Yes</b>
-------------	------------

Total cost ex VAT	<b>1749,84</b>
-------------------	----------------


Wheel cover F L, Missing, E - Replace	<b>22,50</b>
---------------------------------------	--------------



Wheel cover R R, Missing, E - Replace	<b>22,50</b>
---------------------------------------	--------------




Wing R L, Dent(s), LI - Repair and paint (complete) 231,15

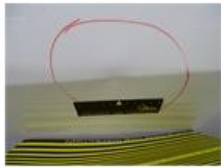

Wheel cover F R, Missing, E - Replace 22,50



Windscreen, Crack, E - Replace 395,40

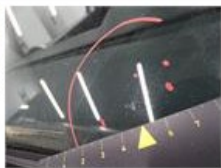

Seat cover F L, Damaged, E - Replace 300,00



Wheel cover R L, Missing, E - Replace 22,50



Wing F R, Scratch(es), LI - Repair and paint (complete) 165,13



Door F L, Dent(s) and scratch(es), LI - Repair and paint (complete) 238,76



Bodywork, Not original part, Acceptable 0,00

No pictures to display

Bumper R, Deformed / Strained, E - Replace 329,40

