



AUDI A3 SPORTBACK: 1JSU866

| | | | |
|------------------------------------|--------------------------|--------------|---|
| Vinnumber: | WAUZZZ8V1FA106751 | Versionname: | 1.4 TFSI 110KW S TRONIC AMBITION |
| First Registrationdate: | 17/02/2015 | Fiscalpower: | |
| Expertise Mileage: | 47016 | Power Kw: | 110 |
| Bodytype: | | Body color: | Grey |
| Gearbox: | Automatic | Paint type: | Metalic |
| Transmission: | Front | Rims summer: | Aluminium |
| Fueltype: | Petrol | Oil level: | OK |
| Maintenance: | OK | Parking lot: | 3102 |
| Battery functioning: | Yes | | |
| Number of doors: | 5 | | |
| Number of seats: | 5 | | |
| Number head rests: | 5 | | |
| Rims summer: | Aluminium | | |
| Category: | Passenger Car | | |
| Oil level: | OK | | |
| Registration Certificate Car (BE): | Yes | | |

Options

| | | | |
|--------------------------------|------------------------------|----------------------|--|
| Radio CD | | Sun Roof electric | |
| GPS storage | SD | Central consol F | |
| GPS storage | | Luggage cover | |
| Windows electric F | | Rear parking sensors | |
| Windows electric R | | | |
| Cruise Control | | | |
| Steering wheel multifunctional | | | |
| Seats F heated | | | |
| Type of headlighting | Headlighting LED | | |
| Type of GPS | GPS big screen color | | |
| Type of Lining | Lining leather | | |
| Type of climate control | Autom climate control | | |

Limited Technical Inspection

| | | | |
|---------------------|-----------|---------------------|------------|
| Airco functioning | OK | Battery functioning | Yes |
| Tires wear profile | OK | Power steering | Yes |
| Idle position | OK | Sound engine | OK |
| Engine startingtime | OK | Clutch test | OK |
| Exhaust gass | OK | Wiper fluid level | OK |
| Handbrake | OK | Transmission | OK |
| | | Lighting | OK |
| | | Wiperblades | OK |

Degree of wear

| | | | | |
|----------------------------------|-------|-----------------------|-------|-----------------------|
| 225/40/18/92 Y LightMetal | | | | |
| Summer tyres: | Fr.L. | Uniroyal: 5 mm | Fr.R. | Uniroyal: 5 mm |
| | Re.L. | Uniroyal: 6 mm | Re.R. | Uniroyal: 6 mm |

Assistance equipment

| | | | |
|------------|------------|------------|------------|
| Repair kit | Yes | Compressor | Yes |
|------------|------------|------------|------------|

| | |
|-------------------|----------------|
| Total cost ex VAT | 1456,88 |
|-------------------|----------------|

| | |
|---|--------------|
| Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete) | 95,00 |
|---|--------------|



Wing R R, Bad repair, Acceptable 0,00



Wing F L, Dent(s), LI - Repair and paint (complete) 268,18



Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80




Bumper F, Scratch(es), LI - Repair and paint (complete) 211,80



Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Rear window, Scratch(es), E - Replace 0,00

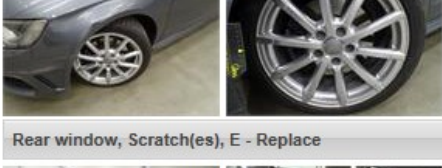

Rearview mirror glass R, Broken, E - Replace 18,00



Sill outer L, Scratch(es), It - Spot repair

115,56



Bumper trim R, Dent(s) and scratch(es), E - Replace

251,54

