



MERCEDES B: 1HKU506

Vinnumber:	WDD2462121J280553	Versionname:	B 180CDI BE Edition 109PK
First Registrationdate:	13/08/2014	Fiscalpower:	
Expertise Mileage:	149817	Power Kw:	80
Bodytype:		Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	NOT OK	Parking lot:	4712
Maintenance:	A1 36 JOURS		
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	HD	Luggage cover	
GPS storage		Type of Tow bar	No Tow bar
Windows electric F			
Windows electric R			
Steering wheel multifunctional			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/91 H LightMetal			
Summer tyres:	Fr.L.	Continental: 6 mm	Fr.R.	Continental: 6 mm
	Re.L.	Bridgestone: 7 mm	Re.R.	Bridgestone: 7 mm

Assistance equipment

Repair kit	Yes	Compressor	No
------------	------------	------------	-----------

Total cost ex VAT	1348,71
-------------------	----------------

Door panel F R, Tear, E - Replace	114,00
-----------------------------------	---------------



Door panel R R, Tear, E - Replace

114,00



Maintenance, Maintenance, Execute

0,00



Bonnet, Stone chip(s), Acceptable

0,00



Compressor, Missing, E - Replace

115,00



Seat cover R, Chemical pollution, E - Replace

360,00



Bumper F, Scratch(es), Acceptable

0,00



Backrest cover F R, Scratch(es), Smart repair

64,32



Steering wheel, Worn, Acceptable

0,00



Door F R, Scratch(es), Acceptable

0,00



Window R R door, Scratch(es), 67 - Polish

55,19




Ignition key, Missing, E - Replace

150,00



Interior, Dirty, Chemical cleaning

150,00

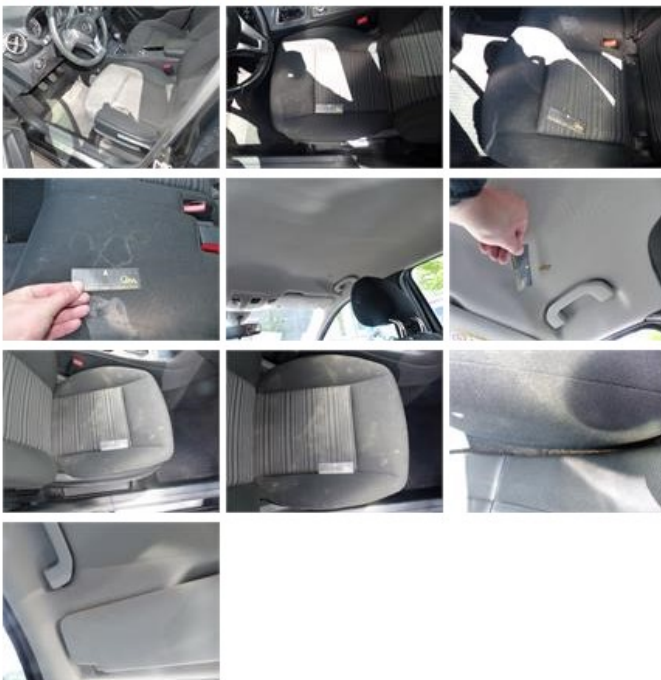

Door R R, Scratch(es), Acceptable

0,00



Door F L, Scratch(es), It - Spot repair

115,56



Trunk lid covering R, Scratch(es), Smart repair

110,64

