



VOLVO XC60: 1KTZ578

Vinnumber:	VV1DZA8C1G2781647	Versionname:	2.0 D4 2WD MOMENTUM
First Registrationdate:	2/07/2015	Fiscalpower:	
Expertise Mileage:	86197	Power Kw:	140
Bodytype:	SUV	Body color:	Dark Grey
Gearbox:	MAN 6 VIT	Paint type:	Metallic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4733
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	Type of Tow bar
Seats F heated	No Tow bar
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining leather
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

235/65/17/108 V LightMetal				
Summer tyres:	Fr.L.	Bridgestone: 5 mm	Fr.R.	Bridgestone: 5 mm
	Re.L.	Pirelli: 7 mm	Re.R.	Pirelli: 7 mm

Assistance equipment


Repair kit	Yes	Compressor	Yes
Total cost ex VAT			888,21
Bumper R, Scratch(es), 67 - Polish			0,00
<i>No pictures to display</i>			
Wing R R, Scratch(es), 67 - Polish			0,00
<i>No pictures to display</i>			
Bumper F, Scratch(es), LI - Repair and paint (complete)			254,16



Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Wing R L, Dent(s) and scratch(es), LI - Repair and paint (complete) 369,84

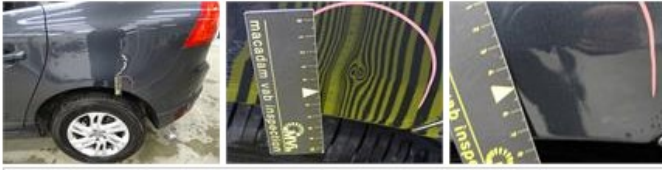

Wing F L, Dent(s) and scratch(es), LI - Repair and paint (complete) 264,21



Door F R, Scratch(es), 67 - Polish 0,00

No pictures to display