


PEUGEOT BOXER: 1KEF956

Vinnumber:	VF3YCTMFB12814890	Versionname:	335 L2H2 2.2 HDI 130 PACK GPS
First Registrationdate:	14/04/2015	Fiscalpower:	
Expertise Mileage:	127682	Power Kw:	96
Bodytype:		Body color	Black
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Steel
Fueltype:	Diesel	Oil level	OK
Maintenance	NOT OK	Parking lot	LCV16
Battery functioning	Yes		
Number of doors	5		
Number of seats	3		
Number head rests	3		
Rims summer	Steel		
Category	VS		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD	Central consol F
GPS storage	Rear parking sensors
GPS storage	HD Type of Tow bar
Windows electric F	Tow bar fixed
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Manual climate control

Limited Technical Inspection


Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	215/70/15/107 S Steel			
Winter tyres:	Fr.L.	Bridgestone: 6,3 mm	Fr.R.	Bridgestone: 6,2 mm
	Re.L.	Michelin: 4,2 mm	Re.R.	Michelin: 4,3 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
Total cost ex VAT			1533,43
Tailgate lock, Strained , E - Replace			150,00

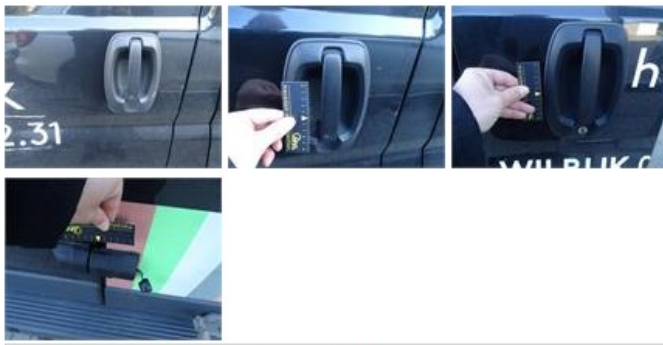

Bodywork, Not original part, Remove lettering

130,00



Wing F R, Dent(s) and scratch(es), LI - Repair and paint (complete)

165,13



Trunk door R L, Scratch(es), Acceptable

0,00

No pictures to display

Sliding door R, Dent(s) and scratch(es), LI - Repair and paint (complete)

382,02



Maintenance, Maintenance, Execute

0,00

No pictures to display

Wheel cover F R, Missing, E - Replace

22,50



Wing R R, Dent(s) and scratch(es), LI - Repair and paint (complete)

231,15



Wheel cover F L, Missing, E - Replace

22,50



Wing trim R R, Missing, E - Replace

69,00



Roof, Dent(s), LI - Repair and paint (complete)

361,13

